

The Commonwealth of Massachusetts

DEPARTMENT OF PUBLIC UTILITIES

PIPELINE ENGINEERING AND SAFETY DIVISION

INCIDENT REPORT

22 Manning Street, Reading Massachusetts

January 25, 2010

PIPELINE ENGINEERING AND SAFETY DIVISION

Accident File

Location: 22 Manning Street, Reading Massachusetts

Date of Accident: January 25, 2010

Gas Company: Boston Gas Company, Essex Gas Company, and Colonial Gas Company each d/b/a National Grid

Estimated Property Damage: *\$250,000

Injuries: One

Report Issued - November 26, 2012

* Estimated by National Grid

Table of Contents

I.	INT	RODUCTION	1
	Α.	Scope of Investigation	1
	В.	Overview of Incident	2
II.	THE	E DEPARTMENT'S INVESTIGATION	3
	A.	Description of the Site	3
	В.	Description of the Scene	4
	C.	Leak Detection	5
	•	1. Post Incident Leak Surveys and Repairs	5
		2. Pre-Incident - Winter Patrol Surveys	5
	D.	Pressure Test of the Service Line	5
	Б. Е.	Odor Calls and Leak Repairs	6
	F.	Odorization	6
III.	ANA	ALYSIS OF THE PIPE SAMPLES	7
IV.	FIN	DINGS AND CONCLUSIONS	8
	A.	Findings	8
	В.	Conclusions	9

EXHIBIT LIST

- 1. Exhibit 1: DOT Incident Report Submitted by National Grid
- 2. Exhibit 2: Reading Fire Department Report
- 3. Exhibit 3: National Grid Report on its Investigation of the Incident
- 4. Exhibit 4: State Fire Marshal Report
- 5. Exhibit 5: Photographs of the Incident
- 6. Exhibit 6: Summary of Records of Gas Mains
- 7. Exhibit 7: Leakage Survey Maps
- 8. Exhibit 8: Post-Incident Reported Leaks and Repairs
- 9. Exhibit 9: Winter Patrol Leak Surveys 2005 to 2010
- 10. Exhibit 10: Pressure Test of Service to 22 Manning Street, Reading
- 11. Exhibit 11: Summary of All Leak Surveys from 2005 to 2012
- 12. Exhibit 12: Odorant Level Tests

I. INTRODUCTION

A. Scope of Investigation

The Massachusetts Department of Public Utilities ("Department"), Pipeline Engineering and Safety Division ("Division"), pursuant to G.L. c. 164, § 105A, and a Federal Certification Agreement as provided for in 49 U.S.C. § 60105, has investigated a natural gas ("gas") release at 22 Manning Street, Reading, on January 25, 2010 ("Incident"). The release of gas contributed to an explosion, and over \$250,000 in property damage to the dwelling, as estimated by the Operator of the natural gas facilities, Boston Gas Company and Colonial Gas Company d/b/a National Grid ("National Grid" or "Operator") (Exh. 1). One individual was injured (Exh. 2).

As part of the Department's annual certification process by the United States

Department of Transportation ("U.S. DOT"), the Department must report to the U.S. DOT

each accident or Incident . . . involving a fatality, personal injury requiring
hospitalization, or property damage or loss of more than an amount the

[&]quot;Incident" means any of the following events:

⁽¹⁾ An event that involves a release of gas from a pipeline, or of liquefied natural gas, liquefied petroleum gas, refrigerant gas, or gas from an LNG facility, and that results in one or more of the following consequences:

⁽i) A death, or personal injury necessitating in-patient hospitalization;

⁽ii) Estimated property damage of \$50,000 or more, including loss to the operator and others, or both, but excluding cost of gas lost;

⁽iii) Unintentional estimated gas loss of three million cubic feet or more;

⁽²⁾ An event that results in an emergency shutdown of an LNG facility. Activation of an emergency shutdown system for reasons other than an actual emergency does not constitute an incident.

⁽³⁾ An event that is significant in the judgment of the operator, even though it did not meet the criteria of paragraphs (1) or (2) of this definition.

Secretary establishes... and any other accident the [Department] considers significant, and a summary of the investigation by the [Department] of the cause and circumstances surrounding the accident or Incident. 49 U.S.C. § 60105(c).

The purpose of this report is to inform the U.S. DOT as to the cause and circumstances surrounding the Incident.

The Department has established procedures for determining the nature and extent of violations of codes and regulations pertaining to safety of pipeline facilities and the transportation of gas, including but not limited to, 220 C.M.R. §§ 101.00 through 113.00.

See 220 C.M.R. § 69.00 et seq. The Division also enforces the U.S. DOT safety standards for gas pipeline systems as set forth in 49 C.F.R. Part 192 ("Part 192"). G.L. c. 164, § 105A.

B. Overview of Incident

On January 25, 2010, at approximately 8:00 p.m., National Grid notified the Department of a house explosion and fire at 22 Manning Street, Reading (Exh. 3). The Department dispatched two investigators to investigate the Incident. The Reading Fire Department reported that one person was admitted to the hospital for observation (Exh. 2, at 3). National Grid operates a 6-inch diameter cast iron gas main² located in the vicinity of the intersection of Manning and Pleasant Streets (Exhs. 3, 4).³

The State Fire Marshal's Office determined that the most probable

... cause of this explosion and subsequent fire was a migration of gas vapors from a cracked six-inch gas main on the street through the soil and into the basement. The vapors most likely entered the basement through two sewage

[&]quot;Main" means a distribution line that serves as a common source of supply for more than one service line.

The leaking gas main was on Pleasant Street, near the intersection of Pleasant Street and Manning street, and in front of the house at 22 Manning Street. The house was at the corner of Manning Street and Pleasant Street.

drain lines as well as the crack in the basement floor. The most likely ignition source . . . was the furnace located in the basement.

(Exh. 4, at 2)

Massachusetts Materials Research, Inc. ("MMR") performed an analysis of the cracked section of gas main and issued a report ("MMR Report"). The report concluded that damage to the cast iron main was believed to have been caused by natural forces associated with temperature changes and subsequent frost heave (MMR Report at 3).

II. THE DEPARTMENT'S INVESTIGATION

A. Description of the Site

Manning Street is in a residential area of Reading with single and two family dwellings. The structure at 22 Manning Street was a 2½ story wood frame structure (pitched roof) with a full basement, and a 1½ story in-law apartment attachment (Exh. 5). The building facade also consisted of wooden clad-board siding, while the foundation was poured concrete (id.). The heating system for the house was located in the basement (id.). Two (2) sewer line clean-outs were observed in the basement; one sewer clean-out was located adjacent to the boiler unit along the rear wall, while the other was located along the center of the opposite wall which is at the front of building (id.). There was also a crack in the concrete slab in the basement floor that ran from the front wall to the back wall (Exh. 4).

The Company reported that the 6-inch diameter cast-iron gas main that underlies Pleasant Street was installed in 1930 (Exh. 6). The portion of the leaking main near the intersection of Manning Street and Pleasant Street was buried four feet deep (id.). At the time of the incident, the operating pressure of the gas main was 1.8 pounds per square inch gauge

("psig") (id.). The MAOP of the system is 2 psig (id.). There was a one-inch plastic gas service supplying gas to 22 Manning Street (id.). The existing gas meter was located outside, on the left side of the house (id.).

B. Description of the Scene

The house at 22 Manning Street, Reading sustained significant structural damage due to the explosion and ensuing fire (Exh. 4). Several exterior walls of the house were pushed out, thus compromising the structural integrity of the building (id.). Interior walls, doors and ceilings also sustained structural damages, while other parts of the house encountered only moderate fire damages (Exhs. 3, 4).

National Grid distribution personnel located the gas leak on the gas main on Pleasant Street - in front of 22 Manning Street - and began excavating in the street to expose the existing cast iron gas main (Exh. 3). At 9 p.m., National Grid exposed the six-inch cast iron main (id.). When the Operator exposed the gas main, it found the main broken, but not completely severed (id.). The break on the main was located directly across the street from 22 Manning Street (id.). The Operator noted that the frost line was approximately twelve inches below the surface (id.).

The Operator cleaned the main, and installed a clamp to secure the leak until permanent repairs were completed—the cracked main was permanently repaired by removing the cracked section of cast iron main, and replacing it was a new segment of plastic pipe (Exhs. 3, 5).

[&]quot;psig" refers to the pressure expressed in pounds exerted on one square inch of surface area. The designation "gauge", indicates the readings are already adjusted to ignore the surrounding atmospheric pressure, which is 14.7 psi at sea level. If psig gauge were not connected to any pressure source, it would read zero even though it is actually sensing 14.7 psi at sea level.

At 7 p.m. (before National Grid exposed the main), National Grid detected gas readings that showed 100 percent gas in sewer manholes on both sides of the house, minimal readings at the water service, and one percent gas at 228 Pleasant Street (Exh. 3).

On January 26, 2010, National Grid permanently removed and replaced the section of main that had fractured, and pressure tested the gas service to 22 Manning Street (Exhs. 8 and 10).

C. Leak Detection

1. Post Incident Leak Surveys and Repairs

After the Incident, National Grid initiated a leak survey, which encompassed the surrounding streets of the Incident location (Exh. 7). National Grid discovered and repaired one leak at 228 Pleasant Street (Exh. 8). During the period January 25 to 29, 2010, additional post-incident leaks were reported and repaired (id.). The repairs were located on Main, Manning, Pleasant, South and Prescott Streets, Reading (id.).

2. Pre-Incident - Winter Patrol Surveys

Prior to the Incident, National Grid had not commenced its Winter Patrol Survey for the 2010 winter season for the affected area (Malden Division) (Exh. 9). Company records indicate that National Grid last conducted winter patrols beginning January 16, 2009 (Exh. 9). The final pass was conducted early spring (March 2009) (id.). The Operator did not detect any main breaks or new gas leaks during said period (id.).

D. Pressure Test of the Service Line

On January 26, 2010, National Grid pressure tested the one-inch service line supplying gas to 22 Manning Street, Reading (Exh. 10). The service line was pressure tested for 15 minutes at 90 psig — no loss in pressure was observed (id.). As such, the gas service was eliminated as one of the possible sources of gas leakage (id.).

E. Odor Calls and Leak Repairs

National Grid reported that the homeowner stated to the Reading Fire Department that he smelled gas in the basement about one hour before the Incident, but did not report it to National Grid (Exh. 3). National Grid did not get an odor call for the Incident site (id.).

From December 30, 2005, to the time of the incident on January 25, 2010, the Operator conducted a series of leak surveys within the affected area (Exh. 9). The Operator conducted both walking and mobile leak surveys during said period.

However, according to the Operator's records, located within the affected area was a number of existing Grade 3 leaks that the Operator monitored and rechecked from 2006 to 2009 (Exh. 11). The Grade 3 leaks were located at 97 and 217 Pleasant Street (id.).

F. Odorization

An operator must odorize the gas in its distribution system of sufficient intensity so that the gas is readily perceptible to the normal or average olfactory senses of a person coming from fresh, uncontaminated air, into a closed room containing 0.15 percent gas in air.

220 C.M.R. § 101.06(20). An operator must also conduct periodic sampling of the gas to assure the proper concentration of odorant throughout its system.

National Grid conducts odorant sampling throughout its system on a monthly basis. On January 25, 2010, National Grid personnel performed odorant measurements at three (3) separate locations in the Town of Reading (Exh. 12). These locations were located in close proximity to the incident. The distinct odor level (DOL) results (in percent gas and air) were as follows:

Location	Threshold Level (% Gas in Air)	Distinct Odor Level (% Gas in Air)
Lowell Street (Reading take Station):	0.04	0.10
John @ Haven Street (Regulator Station):	0.03 0.04	0.07 0.09
235 Pleasant Street, Reading	0.05	0.09 0.10

(Exh. 12)

The odor detection levels indicate that the odorant was within the limit prescribed by the State regulation (id.). The odorant levels also met the federal pipeline safety requirement, contained in Part 192, § 192.625, which requires that gas be odorized so that it can be detected at a level of one percent gas and air.

III. ANALYSIS OF THE PIPE SAMPLES

MMR performed an analysis of the cracked section of 6-inch cast iron gas main supplying gas to 22 Manning Street, Reading. MMR issued a report on the results of its analysis ("MMR Report").⁵ The MMR Report at 10-11, noted that:

Although this incident pipe was spun cast, its chemistry (wt. % phosphorous) and metallurgy are more like a pit cast pipe. These in combination with a notable amount of shrinkage porosity resulted in a pipe that would be weaker than the average spun cast pipe and more typical of a pit cast pipe in behavior. Many times, when a spun cast pipe exhibits anomalous microstructure, it is the result of the manufacturing technique of the company that made it.

The MMR Report concludes that:

Copies of the MMR report can be obtained by contacting: Veda-Anne Ulcickas, Massachusetts Materials Research, Inc., P.O. Box 810, Century Drive, West Boylston, MA 01583

This pipe exhibited a classic transverse fracture due to bending loads. Subsurface soils are not static and their variations along the length of a pipe can produce variable tensile, compressive, and bending loads. Additionally, variations in soil/backfill composition and saturation can affect responses to freeze/thaw cycles and heavy precipitation. A combination of graphitic corrosion, porosity, and anomalous microstructure would have produced a spun cast pipe that was weaker than others more typical of that casting method. This pipe was metallurgically more similar to older pit cast pipes and thus would be more sensitive to soil loading than the average spun cast sample.

IV. FINDINGS AND CONCLUSIONS

A. Findings

- 1. National Grid operates the natural gas distribution facilities in Reading, MA.
- 2. A 6-inch diameter cast-iron gas main underlies Pleasant Street, Reading.
- 3. The maximum allowable operating pressure of the main was 2 psig.
- 4. The cast iron main on Pleasant Street was installed in 1930.
- 5. From 2006 to 2009, the Company monitored a number of existing non-hazardous Grade 3 gas leaks at 97, and 217 Pleasant Street.
- 6. National Grid conducted its first pass of winter patrol surveys in January 2009, and concluded its last pass before the Incident in March 2009.
- 7. These winter patrol surveys did not detect any main breaks or new gas leaks.
- 8. The Operator had no records of maintenance or replacement of gas mains within close proximity to 22 Manning Street.
- 9. The house at 22 Manning Street, Reading had gas service provided by National Grid.
- 10. The basement of the house at 22 Manning Street, Reading had a sewer line.
- 11. On January 25, 2010 natural gas was released into 22 Manning Street, Reading, that ignited, and significantly damaged the home.
- 12. On January 25, 2010, National Grid located a gas leak on the cast-iron gas main in front of 22 Manning Street.
- 13. On January 25, 2010, the service line to 22 Manning Street did not leak any gas.
- 14. The operating pressure of the main at the time of the failure was 1.8 psig.

B. Conclusions

The State Fire Marshal Report concludes that gas most likely migrated into the basement of the house from the cracked cast iron main on Pleasant Street - in front of 22 Manning Street - through the soil, into the basement, through the two existing sanitary sewer lines and the cracks in the basement floor. This conclusion is reasonable, and supported by the evidence in this investigation. The most likely point of ignition of the gas was the furnace located in the basement area.

The MMR conclusion that the failed pipe exhibited a classic transverse fracture due to bending loads is reasonable, and supported by the evidence in this investigation. A main cause of bending loads in the soil surrounding this pipe is most likely frost heaves.

EXHIBIT 1

DOT Incident Report Submitted by National Grid

	N		
NOTICE: This report is required by 49 \$100,000 for each violation for each da exceed \$1,000,000 as provided in 49 U	v that such violation persists except the	n result in a civil penalty not to exceed at the maximum civil penalty shall not	OMB NO: 2137-0522 EXPIRATION DATE: 01/31/2013
	WAIRENT DEPART	CAC DISTRIBUTION	Report Date
S. Department of Transportation		- GAS DISTRIBUTION STEM	No.
ipeline and Hazardous Materials Safety Administration	513	DIEM	
		andred to respect to the best to	(DOT Use Only)
comply with a collection of informaticurrent valid OMB Control Number information is estimated to be approximately and reviewing the collections.	on subject to the requirements of The OMB Control Number for to eximately 10 hours per response, ction of information. All response	the Paperwork Reduction Act unit this information collection is 2137-t, including the time for reviewing in the tothis collection of information a tion, including suggestions for reductions.	person be subject to a penalty for failure to ess that collection of information displays a 0522. Public reporting for this collection of structions, gathering the data needed, and are mandatory. Send comments regarding ucing this burden to: Information Collection on, D.C. 20590.
INSTRUCTIONS			
Important: Please read to information requested and pone from the PHMSA Pipeline	provide specific examples. Safety Community Web Pa	for completing this form bef If you do not have a copy at <u>http://www.phmsa</u>	of the instructions, you can obtain
PART A - KEY REPORT INFORMA	TION "Report Type:	(select all that apply)x . Origina	Supplemental x₀ Final
"1. Operator's OPS-issued Operator_ "2. Name of Operator: E	Identification Number (OPID): Boston Gas Company	: / 1/6/ 4/ /0 /	
""3. Address of Operator:		#	
3.a 40 Sylvan Road	6	9•0	
(Street Addre	ss)		
3.b Waltham (City) /			
3.c State: /M /A /			
3.d Zip Code: 0/2 /4 /5 /1 /		27 - 1	
	of the Incidents	"6. National Respon4e Center	Report Number :
""4. Local time (24-hr clock) and date	CONTRACTOR OF STATE OF STATE OF STATE	/ 9/ 2/9/6/4/3/	Report Number .
1 . 1707 . Of C.	1/ 2/ 5/ 2/ 0/ 1/ 0/ Day Year		
. KOUI ·	. (22)	· ·	
""5. Location of Incident:		77. Local time (24-hr clock) and	date of initial telephonic report to the
5.a 22 Manning Street		National Response Center.	
(Street Address or lo	cation description)	2/ 1/ 0/ 0/	0/ 1/ 2/ 5/ 2/ 0/ 1/ 0/
		Hour	Month Day Year
5.b Reading (Cit	(y)	-	
			9
5.c Middlesex (County or F	Parich)	-	.e
# 14.5 #	anony		*
5.d State: / M/A/		1	
5.e Zip Code: 0/ 1/8 /6 /7 / /	. 1		
5.f Latitude: / / / ./ /	7 7 7 7	1	
		-	951
Longitude: - / / / / . /			
*8. Incident resulted from:			5
	s		•
∠ Unintentional release of gas ☐ Intentional release of gas	म्		
Reasons other than release	of gas		
9. Gas released:	#5 *	3.0	⊕.
X Natural Gas			
Propane Gas			
Other Gas E:> Name:	1 1 1,1 1	•	9
7. Estimated volume of gas ased:	r r nr l	/ / Thousand Cubic Feet (.	

**11. Were there fatalities? • Yes X No		30 to 10 to	g inpatient hospitalization? X. Yes No
If Yes, specify the number in each category	:	. If Yes, specify the number in	each category:
11.a Operator employees	<u> </u>	12.a Operator employees	1 1 1 01
11.b Contractor employees working for the Operator		12.b Contractor employees working for the Operator	<u> </u>
11.c Non-Operator emergency responders	<u> </u>	12.c Non-Operator emergency responders	1111
11.d Workers working on the right-of-way, but NOT associated with this Operator		12.d Workers working on the right-of-way, but NC associated with this Operator	
Water Andrews Control Control		14.1A	47 NO VOID 1/2004
11.e General public		12.e General public	<u> </u>
11.f Total fatalities (sum of above)	1 1 1 01	12.f Total injuries (sum of above)	[
**13. Was the pipeline/facility shut down due to to . Yes Xo No & Explain: If Yes, complete Questions 13.a and 13.b: 13.a Local time and date of shutdown		clock) / / / / / / / / / / / / / / / / / / /	
13.b Local time pipeline/facility restarted	/ / / / / Hour	Month Day Year	• Still shut down* (*Supplemental Report required)
**14. Did the gas ignite? X Yes . No		*	*
**15. Did the gas explode?X . Yes No	a S	¥	
16. Number of general public evacuated: / /	1,1 1 1 31		
17. Time sequence (use local time, 24-hour	clock):	8	
17.a Local time operator identified Incident	11 / 8//0		2/0/1/0
17.b Local time operator resources arrived of	on site / 1 / 8 Hour	/ 3 / 7 / / 0 / 1 / 2 / 5 / 2 Month Day	/ Year / 0/ 1/0 Year

PART	В-	- ADDITIONAL LOCATION INFORMATION
14. M	ខន	the Incident on Federal land? . Yes XNo
2. L	.002	ation of Incident: (select only one)
1		Operator-controlled property
1)	Public property
X	(Private property
)	Utility Right-of-Way / Easement
**3. A	rea	of Incident: (select only one)
	ΧŲ	nderground Specify:X "Under soil . Under a building . Under pavement . Exposed due to excavation . In underground enclosed space (e.g., vault) . Other
		Depth-of-Cover (in):
_	3	Transition Area Specify: • Soll/air interface • Wall sleeve • Pipe support or other close contact area • Other
		ncident occur in a crossing? • Yes X No , specify type below:
		Bridge crossing b Specify: Cased . Uncased
	R	Railroad crossing b (Select all that apply). Cased . Uncased . Bored/drilled
	*	Road crossing b (Select all that apply) . Cased . Uncased . Bored/drilled
	V	Vater crossing b (Select all that apply) . Cased . Uncased . Bored/drilled
		Name of body of water (If commonly known):
		Approx. water depth (ft): /////

PART C - ADDITIONAL FACILITY INFORMATION	
 Indicate the type of pipeline system: 	
X Natural Gas Distribution, privately owned	2 0
□ Natural Gas Distribution, municipally owned	
☐ Petroleum Gas Distribution	3
Other ., Specify:	
	XMain Service Service Riser Outside Meter/Regulator set Inside Meter/Regulator set Farm Tap Meter/Regulator set District Regulator/Metering Station Valve Other District Regulator/Metering Valve
	involved in Incident* (from PART C, Question 2), provide the following:
3.b Pipe specification (e.g., API 5L, ASTM D2513):	
3.c Pipe manufacturer:	or 。 Unknown
4. Material involved in Incident: • Steel X. Cast/Wroug	oht Iron 。 Ductile Iron 。 Copper 。 Plastic 。 UnknownOther b Specify:
4.a. If Steel Specify seam type:	or . None or . Unknown
4.b. If Steel . Specify wall thickness (inch	es): <u>/ /./ / /</u> / or _• Unknown
4.c. If Plastic - Specify type: Polyvinyl Chloride Polybutylene (PB) Polyamide (PA) Other Unknown	。Polypropylene (PP) 。Acrylonitrile Butadiene Styrene (ABS) Cellulose Acetate Butyrate (CAB)
4.d. If Plastic Specify Standard Dimension	n Ratio (SDR): //// or wall thickness: //////or . Unknown
1 A A REC	tic in PART C, Question 4.c . esignation Code (i.e., 2406, 3408, etc.) <u>PE ////</u> or 。Unknown
5. Type of release involved: (select only one)	_/in. (axial) by //_/_/./_/in. (circumferential)
□ XLeak Select Type: • Pinhole X Crack	。Connection Failure □ Seal or Packing Other
D Runture Select Orientation: . Circumferential	Longitudinal Other
Approx. size: /_/_/_/_/ in. (v Other Describe: Crack found on 6 inch cast in	videst opening) by /_/_/_/.//in. (length circumferentially or axially) on main

PART D - ADDITIONAL CONSEQUENCE INFORMATION		*										
**1. Class Location of Incident: (select only one)					×.							
Class 1 Location				1840							(4)	
Class 2 Location												
X Class 3 Location Class 4		(1)										
**2. Estimated cost to Operator :	\$/	1	1	•		1			1			
2.a Estimated cost of public and non-Operator private property damage paid/reimbursed by the Operator												\$250,00
2.b Estimated cost of gas released	\$1	1	1	1,1	1	1	1,1	1	1	1		*
	\$1	1	1	IJ	1	1	17	1	1	1		
2.c Estimated cost of Operator's property damage & repairs	\$/	1	1	1,1	7	1	1,1	1	1	1		
2.d Estimated cost of Operator's emergency response	\$1	1	1		1	1		1	1	1		
2.e Estimated other costs Describe:			1	1.1	1	1	1,1	1	1	1	4	7
2.f Estimated total costs (sum of above)	\$/	7		1,1			Į,J					\$250,000
3. Estimated number of customers out of service: 3.a Commercial entities / /,/ / / /	<u> </u>					×			ē			
3.b Industrial entities / I,I 1 /	=											
3.c Residences / /./ / 4/	-2											

DART	E - ADDITIO	ONAL OPERATING INFORMATION			A.	
*1.		pressure at the point and time of the Inc	cident (psig):	10	/ /1 /. /8 /	
}		rating pressure at the point and time of			111.181	
'2. 1 ••3.	Mavimum	Allowable Operating Pressure (MAO	P) at the point and	time of the	Incident (psig): <u>/ /2 /. /0</u>	
**4.	Describe th	e pressure on the system relating to the Pressure did not exceed MAOP	Incident: (select onl	y one)		
	X	Pressure exceeded MAOP, but did not Pressure exceeded 110% of MAOP	exceed 110% of MAC	P		
	Cupania	ory Control and Data Acquisition (SCADA	()-based system in pla	ce on the pipe	eline or facility involved in the Incid	dent?
l r	D No					
;	X Yes b 5.4	Was it operating at the time of the Inc		XYes	, No	
		5.b Was it fully functional at the time of t	he Incident?	XYes	。No	
		5.c Did SCADA-based information (suc	n as alarm(s), alert(s),	event(s), and	X No	issist with the
		detection of the Incident? 5.d Did SCADA-based information (suc	h ac alarm(c) alert(s)			ith the
		confirmation of the Incident?	in as alamin(s), ciente)	د Yes	X No	
		I to the second			** **	
6. How	was the Inci-	dent initially identified for the Operator? (select only one)	luma ar naak	coloulations)	
	SCADA-ba	sed information (such as alarm(s), alert(-in Test or Other Pressure or Leak Test	s), event(s), and/or vo	iume or pack	Calculations	
	Controller		Local Operating	g Personnel,	including contractors	
Е	Air Patrol		₀ Ground Patrol			
г	Notification	from Public	X ₅ Notification from	m Emergenc	y Responder	
	Notification	from Third Party that caused the Inciden	t other		and Datral by Operator or its contro	ester' in polosted
6. in	a If "Control	er, "Local Operating Personnel, includin specify the following: (select only one)			no Patrol by Operator of its contra	icioi is selecteo
37.5		X Operator employee . Contracto	or working for the Ope	erator	· ·	
		tion initiated into whether or not the contro	oller(s) or control room	issues were t	he cause of or a contributing factor	to the
/. Was	aidant? (sele	ctoniv one)				
***		yes, but the investigation of the control ro	om and/or controller at	ctions has not	yet been completed by the operati	OT .
		ental Report required) No, the facility was not monitored by a co	ontroller(s) at the time	of the Incide	nt	
v	_	un in the transfer of the	ha controllaria) actions	or control mo	m issues was necessary due to:	
X	(provide a	n explanation for why the operator did no	ot investigate) Not app	olicable since	this was leak caused by crack on	
	single mai	n	·			
	5 V-5 (Specify investigation result(s): (select all	that apply)			
	. In	vestigation reviewed work schedule rotat	lions, continuous hour			
	l m	vesligation did NOT review work schedul ors associated with fatigue (provide an e	e rotations, continuou	s hours of se	rvice (while working for the Opera	tor) and other
		The second of	3			
	•					
	١n١ء	restigation identified no control room	ssues			
	Inv	estination identified no controller issu	ies			
	۰ln۱	restigation identified incorrect controlle estigation identified that fatigue may hav	r action or controller	error er/s) involved	or impacted the involved controlle	er(s)
	· Inv		e allecteo trie controll	ci(c) involved		
	1	estigation identified incorrect procedu	ıres		.	
		id-alified incorrect control for	nom equinment oner	ation	rations procedures and/or contro	oller response
	, Inv	restigation identified incorrect control in estigation identified maintenance activit vestigation identified areas other than	those above - Desc	ribe:	allerie, procedures, alluror contic	
	<u>، In</u>	vestigation identified areas other than	Mood about B Door			

PART F - DRUG & ALCOHOL TESTING INFORMATION	
1 **1. As a result of this Incident, were any Operator employees tested under the post-accidence of the Prug & Alcohol Testing regulations?	dent drug and alcohol testing requirements of DOT's
OX No Yes b 1.a Specify how many were tested: [/ 0/	*
1.b Specify how many failed: <u>/ / 0/</u>	v
**2. As a result of this incident, were any Operator contractor employees tested under the DOT's Drug & Alcohol Testing regulations?	post-accident drug and alcohol testing requirements of
X No O Yes b 2.a Specify how many were tested: 2.b Specify how many failed:	*
,	į

PART G - APPARENT CAUSE	APPARENT Cause of the Incident, and answer the questions on the right. Describe secondary, contributing, or root causes of the Incident in the narrative (PART H).
G1 - Corrosion Failure - **only or	ne sub-cause can be picked from shaded left-hand column
External Corrosion	**1. Results of visual examination: Localized Pitting
	2. Type of corrosion: (select all that apply) Galvanic Atmospheric Stray Current Microbiological Selective Seam Other
2 · 4 · 6	3. The type(s) of corrosion selected in Question 2 is based on the following: (select all that apply) • Field examination • Determined by metallurgical analysis • Other
8	**4. Was the failed item buried under the ground? 4. Yes .
	• No 4.b Was shielding, tenting, or disbonding of coating evident at the point of the incident? • Yes • No
* · · · · · · · · · · · · · · · · · · ·	4.c Has one or more Cathodic Protection Survey been conducted at the point of the incident? Yes, CP Annual Survey Most recent year conducted: / / / / /
¹² . • 0	Yes, Close Interval Survey, Most recent year conducted: / / / /
	. Yes, Other CP Survey . Most recent year conducted: / / / /
	No No Ad Was the failed item externally coated or painted? Yes No 5. Was there observable damage to the coating or paint in the vicinity of the corrosion?
	• Yes • No
	6. Pipeline coating type, if steel pipe is involved: (select only one) • Fusion Bonded Epoxy • Coal Tar • Asphalt • Polyolefin • Extruded Polyethylene • Field Applied Epoxy • Cold Applied Tape • Paint • Composite • None
	. Unknown

☐ Internal Corrosion	**7. Results of visual examination: Localized Pitting General Corrosion Not cut open Other
1	8. Cause of corrosion: (select all that apply) 。Corrosive Commodity 。Water drop-out/Acid 。Microbiological 。 Erosion 。Other
	9. The cause(s) of corrosion selected in Question 8 is based on the following; (select all that apply) • Field examination • Determined by metallurgical analysis • Other
51	10. Location of corrosion: (select all that apply) Low point in pipe Elbow Drop-out Other
	**11. Was the gas/fluid treated with corrosion inhibitors or biocides? . Yes . No
	12. Were any liquids found in the distribution system where the Incident occurred? . Yes No
Complete the following if any Corrosion Fallure	sub-cause is selected AND the "Part of system involved in Incident" (from PART
Question 2) is Main, Service, or Service Riser. *13. Date of the most recent Leak Survey	C, // / / / / / / / /
**13. Date of the most recent Leak Survey conducted:	Month Day Year
**14. Has one or more pressure test been conducted	since original construction at the point of the Incident? / / / Test pressure (psig): / / / / /
。No	
G2 - Natural Force Damage - **	only one sub-cause can be picked from shaded left-handed column
☐ Earth Movement, NOT due to Heavy Rains/Floods	**1. Specify: ه Earthquake ه Subsidence ه Landslide و Other
☐ Heavy Rains/Floods	2. Specify: Washouts/Scouring & Flotation & Mudslide & Other
☐ Lightning	3. Specify: • Direct hit • Secondary impact such as resulting nearby fires
XTemperature	**4. Specify: . Thermal Stress X. Frost Heave . Other
☐ High Winds	
	**5. Describe:
Other Natural Force Damage	
Complete the following if any Natural Force Damage	sub-cause is selected.
6. Were the natural forces causing the Incident	generated in conjunction with an extreme weather event? . Yes . No
6.a. If Yes, specify: (select all that apply)	¿ Hurricane " Tropical Storm " Tornado
The second secon	, Other

G3 - Excavation Damage - "or	nly one sub-cause can be pi	ked from shaded left-hand c	olumn
☐ Excavation Damage by Operator (First Party)			
☐ Excavation Damage by Operator's Contractor (Second Party)			
☐ Excavation Damage by Third Party		3	* * *
☐ Previous Damage due to Excavation Activity	Question 2) is Main, Service "*1. Date of the most recomment "2. Has one or more pre- the incident?	ee, or Service Riser. ent Leak Survey conducted:	volved in Incident" (from PART C, / / / / / / / / / / / / Day Year nce original construction at the point of
	Test pressure (psig):	1	
	, No		· • •
Complete the following if Excavation Damag "3. Did the operator get prior notification of the 3.a if Yes, Notification received from: (sele	excavation activity? . Yes	s . No all System . Excavator	Contractor Landowner
■ Do you want PHMSA to upload the follow ■ Right-of-Way where event occurred: (s □ Public → Specify: • City Street □ Private → Specify: • Private Landown □ Pipeline Property/Easement □ Power/Transmission Line □ Railroad □ Dedicated Public Utility Easement □ Federal Land □ Data not collected □ Unknown/Other	elect all that apply) State Highway County		。No vay 。Other
"6. Type of excavator: (select only one)		Municipality	。 Occupant
Commence	eveloper .Farmer tility .Data not c	Municipality ollected .	• Unknown/Other
 Type of excavation equipment: (select Auger Explosives Probing Device Trencher	only one) e Boring Grader/Scraper Vacuum Equipmen	Drilling Hand Tools Data not collected	Directional Drilling Milling Equipment Unknown/Other
	Other	Building Construction Engineering/Surveying Liquid Pipeline Railroad Maintenance Storm Drain/Culvert Water	Building Demolition Fencing Milling Road Work Street Light Waterway Improvement

Time	Locator: ¿Utility Owner ¿Co	ntractor Loc	cator	. Data not collected	. Unknown/Other
	acility locate marks visible in the area of excavation?	No	, Yes	Data not collected	₀ Unknown/Other
	slittles marked correctly?	e No	، Yes	Data not collected	. Unknown/Other
		ь No	٤Yes	Data not collected	₀ Unknown/Other
	damage cause an interruption in service? 3.a If Yes, specify duration of the interruption:		_/ hours	4	3
Description choice,	on of the CGA-DIRT Root Cause (select only the one pr the one predominant second level CGA-DIRT Root Cau	se as well).	irst level C	GA-DIRT Root Cause an	d then, where availabl
		only one)			
	 No notification made to the One-Call Center Notification to One-Call Center made, but not Wrong information provided 	sufficient			7F
	Locating Practices Not Sufficient: (select only one)				
	 Facility could not be found/located Facility marking or location not sufficient Facility was not located or marked 				
	Incorrect facility records/maps				
. <u>D</u>	Excavation Practices Not Sufficient: (select only one)				*
la .	 Excavation practices not sufficient (other) Failure to maintain clearance 				
	Failure to maintain the marks				
	Failure to support exposed facilities		*:		
	 Failure to use hand tools where required Failure to verify location by test-hole (pot-holin Improper backfilling 	g)		* 3e	
D	One-Call Notification Center Error			*	A48
<u>D</u>	Abandoned Facility				
₽	Deteriorated Facility				i. 1€ j
₽	Previous Damage				24.
<u>D</u>	Data Not Collected			(*):	
18 5 5363	Other / None of the Above (exolain)	8			¥

G4 - Other Outside Force Dan	nage - **only one sub-cause can be selected from the shaded left-hand column
☐ Nearby Industrial, Man-made, or Other Fire/Explosion as Primary Cause of Incident	
□ Damage by Car, Truck, or Other Motorized Vehicle/Equipment NOT Engaged in Excavation	**1. Vehicle/Equipment operated by: (select only one) Operator Operator Third Party
☐ Damage by Boats, Barges, Drilling Rigs, or Other Maritime Equipment or Vessels Set Adrift or Which Have Otherwise Lost Their Mooring	**2. Select one or more of the following IF an extreme weather event was a factor: . Hurricane . Tropical Storm . Tornado . Heavy Rains/Flood . Other
☐ Routine or Normal Fishing or Other Maritime Activity NOT Engaged in Excavation	
□Electrical Arcing from Other Equipment or Facility	-
☐ Previous Mechanical Damage NOT Related to Excavation	Complete the following ONLY IF the "Part of system involved in Incident" (from PART C, Question 2) is Main, Service, or Service Riser. **3. Date of the most recent Leak Survey conducted: / / / / / / / / / / / / / / / /
, e	Month Day Year **4. Has one or more pressure test been conducted since original construction at the point of the Incident? Yes b Most recent year tested: / / / / /
S s ×	Test pressure (psig): / / / / / / / / / / / / / / / / / / /
□ Intentional Damage	5. Specify: Vandalism Terrorism Theft of transported commodity Other
□ Other Outside Force Damage	**6. Describe:
Ŧ	

G	G5 - Pipe, Weld, or Joint Failure - **only one sub-cause can be selected from the shaded left-hand column				
<u> </u>	Body of Pipe	1. Specify: Dent Gouge Bend Arc Burn Crack Other			
	Butt Weld	2. Specify: • Pipe • Fabrication • Other			
<u> </u>	Fillet Weld	3. Specify: Branch Hot Tap Fitting Repair Sleeve Other			
0	Pipe Seam	4. Specify: LF ERW DSAW Flash Weld HF ERW SAW Spiral Other			
D	Threaded Metallic Pipe				
	Mechanical Fitting	Specify the mechanical fitting involved: Stab type fitting			
	,	6. Specify the type of mechanical fitting:			
		7. Manufacturer:			
		8. Year manufactured: / / / /			
		9. Year installed: / / / /			
	20	10. Other attributes:			
		11. Specify the two materials being joined: 11.a First material being jointed: Steel Cast/Wrought Iron Ductile Iron Copper Plastic Unknown Other Specify:			
	*	11.b If Plastic D Specify: Polyvinyl Chloride (PVC) Polyethylene (PE) Cross-linked Polyethylene (PEX) Polybutylene (PB) Polypropylene (PP) Acrylonitrile Butadiene Styrene (ABS) Polyamide (PA) Cellulose Acetate Butyrate (CAB) Other Specify:			
		11.c Second material being joined: Steel Cast/Wrought Iron Ductile Iron Copper Plastic Unknown Other Specify:			
	a a	11.d If Plastic B Specify: Polyvinyl Chloride (PVC) Polyethylene (PE) Cross-linked Polyethylene (PEX) Polybutylene (PB) Polypropylene (PP) Acrylonitrile Butadiene Styrene (ABS) Polyamide (PA) Cellulose Acetate Butyrate (CAB) Other Specify:			
		12. If used on plastic pipe, did the fitting – as designed by the manufacturer – include restraint? • Yes • No • Unknown 12.a If Yes, specify: • Cat. I • Cat. II • Cat. III • DOT 192.283			

☐ Compression Fitting	,
36.	13. Fitting type:
	14. Manufacturer:
	15. Year manufactured: / / / / /
- X	16. Year installed: / / / / /
3.	17. Other attributes
	18. Specify the two materials being joined:
	18.a First material being jointed:
	Steel • Cast/Wrought Iron
*	Ductile Iron : Copper Delastic
	□ Unknown .
	Other Specify:
1	18.b If Plastic D Specify: Polyvinyl Chloride (PVC) Polyethylene (PE)
170	ه Cross-linked Polyethylene (PEX) ه Polybutylene (PB)
¥ .	Polypropylene (PP) Acrylonitrile Butadiene Styrene (ABS)
	Polyamide (PA) Cellulose Acetate Butyrate (CAB)
	Other - Specify:
	18.c Second material being joined:
1	Steel Cast/Wrought Iron
	Ductile Iron • Copper • Plastic
	☐ Unknown ☐ Other Specify:
2 10	18.d If Plastic D Specify: Polyvinyl Chloride (PVC) Polyethylene (PE)
a	。Cross-linked Polyethylene (PEX) Polybutylene (PB)
. *	Polypropylene (PP) Acrylonitrile Butadiene Styrene (ABS)
	。Polyamide (PA) 。Cellulose Acetate Butyrate (CAB)
SEC	Other Specify:
☐ Fusion Joint	19. Specify. Butt, Heat Fusion Butt, Electrofusion Saddle, Heat Fusion
•	. Saddle, Electrofusion . Socket, Heat Fusion . Socket, Electrofusion
İ	o Other
	20. Year installed: / / / /
	21. Other attributes:
	22. Specify the two materials being joined:
ε ·	22.a First material being jointed:
us d a	Polyvinyl Chloride (PVC) Polyethylene (PE)
	Cross-linked Polyethylene (PEX) Polybutylene (PB)
	Polypropylene (PP) Acrylonitrile Butadiene Styrene (ABS)
	Polyamide (PA) Cellulose Acetate Butyrate (CAB)
	。Other Specify:
	22 h Casand material haing island:
ļ	22.b Second material being joined: • Polyvinyl Chloride (PVC) • Polyethylene (PE)
	Cross-linked Polyethylene (PEX) Polybutylene (PB)
" 2	Polypropylene (PP)
	Polyamide (PA) Cellulose Acetate Butyrate (CAB)
	Other Specify:
Other Pipe, Weld, or Joint Failure	BHO2 Describet
	23. Describe.
Other Pipe, Weld, or some control	*"23. Describe:

Complete the following if any Pipe, Weld	or Joint Fallure sub-cause is selected.	
24. Additional Factors: (select all that apple Lamination Buckle) . Other	y) 。Dent 。Gouge 。Pipe Bend 。Arc Burn 。Crack 、Lack of Fusion 。Wrinkle 。Misalignment 。Burnt Steel	
25. Was the Incident a result of: Construction defect, specify: of Material defect, specify: Long		
Design defect		
Previous damage	· ·	
26. Has one or more pressure test been conducted c Yes . Most recent year tested: /	since original construction at the point of the Incident? / / / Test pressure (psig): / / / / /	
, No		
G6 - Equipment Failure-**or	nly one sub-cause can be selected from the shaded left-hand column	
Malfunction of Control/Relief Equipment	**1. Specify: (select all that apply) Control Valve Communications Block Valve Relief Valve Power Failure Stopple/Control Fitting Pressure Regulator Other	
Threaded Connection Fallure	**2. Specify: • Pipe Nipple • Valve Threads • Threaded Pipe Collar • Threaded Fitting • Other	
Non-threaded Connection Failure	**3. Specify: . O-Ring . Gasket . Other Seal or Packing . Other	
• Valve	4. Specify: Manufacturing defect Other	
	5.a Valve type:	
5.b Manufactured by:		
	5.c Year manufactured: / / / /	
Other Equipment Failure	**5. Describe:	
20 034-0955 TO TO		

G7 - Incorrect Operation - "only	one sub-cause can be selected from the shaded left-hand column
☐ Damage by Operator or Operator's Contractor NOT Related to Excavation and NOT due to Motorized Vehicle/Equipment Damage	
Valve Left or Placed in Wrong Position, but NOT Resulting in an Overpressure	
☐ Pipeline or Equipment Overpressured	
□ Equipment Not Installed Properly	
☐ Wrong Equipment Specified or Installed	*
Other Incorrect Operation	**1. Describe: .
4.a If Yes, were the individuals performing . Yes, they were qualified for . No, but they were performing . No, they were not qualified for qualified individual	ormal operations or emergencies) d as a covered task in your Operator Qualification Program? X Yes No ng the task(s) qualified for the task(s)? the task(s) under the direction and observation of a qualified individual or the task(s) nor were they performing the task(s) under the direction and observation of a
38 - Other Incident Cause - only o	one sub-cause can be selected from the shaded left-hand column
Miscellan eous	**1. Describe:
Unknown	**2. Specify: • Investigation complete, cause of Incident unknown • Situate investorion caused indentible distribut (Supplemental Report required)

PART H - NARRATIVE DESCRIPTION OF THE INCIDENT	. (Attach additional sheets as necessary)
	•
,	
	*
- ·	
	,
	e. s
ART I - PREPARER AND AUTHORIZED SIGNATURE	
A CONTRACTOR OF THE PARTY OF TH	0.0 0.00
Christopher S. Arnsir varier's Name (type or print)	Preparer's Telephone Number
Servin Caunge	
are/s Title (type or print)	(- 10 - 2 - 2 - 1
Christopher. aronsin @ us. Ngrid. Co	681 907-5701
arer's E-mail Address	Preparer's Facsimile Number 787 - 7854
Chastrolic S. Armur	Date Authorized Signature Telephone Number
Chastopher S. Trans	
MARCI CHAMBIOLO & HERRING (A) Es or Print)	
OL	

EXHIBIT 2

Reading Fire Department Report

dail 20 10 11 1					
A 17246 MA DD 25 Incident Date	YYYY 2010 HQ 10-0000317 000 Change Basic * Station Incident Number * Exposure * No Activity				
Thech, this box to Indicate that the address for this incident as growing on the Wildland Fare Census Tract - Nodele In Section 5 "Alternative location Specification", Use only for Haldland fires.					
Street address 22	Manning Street ix street or Bighway eading MA 01867 State zip Code				
	ections, as applicable Midnight is 0000 E2 Shift & Alarms				
C Incident Type * 111 Building fire Incident Type D Aid Given or Received*	E1 Date & Times Check boxes if Month Day Year Hr Min Sec dates are the saws at Alarm Alarm & O1 25 2010 18:01:00 shift or Alarm District ARRIVAL required, unless canceled or did not arrive				
1 X Nutural aid received 2 Automatic aid recv. 3 Mutural aid given 4 Automatic aid given 5 Other aid given N None 17284 Their FDID Their State Their FDID Their State Incident Number	X Arrival & 01 25 2010 18:04:00 E3 Special Studies				
F Actions Taken *	G1 Resources * G2 Estimated Dollar Losses & Values Check this box and skip this LOSSES: Required for all first if known. Optional				
DOA Investigate & Provided Primary Action Taken (1)	Suppression 0005 Contents \$, 025, 000				
Additional Action Taken (2)	EMS PRE-INCIDENT VALUE: Options:				
Additional Action Taken (3)	Other Property \$, 450, 000				
Audition	include aid received resources. Contents \$,				
mpleted Modules Fire-2 Deaths Ing Structure-3 Civil Fire Cas4 Fire Serv. Cas5 EMS-6 HazKat-7 wildland Fire-8 Apparatus-9 Personnel-10 Arson-11 Deaths Ing Civilian Fire Service Pire Service Civilian Liputation Detector Required for Confined 1 Detector alerted on U Detector did not all U Detector did not all U Detector did not all	Natural GBS: alow leak, so evaluation or Rankot actions Natural GBS: alow leak, so evaluation or Rankot actions Propade gBS: all lb. tank (as in home \$10 grill) GBS oline: which feel tank or portable container Kerosene: deal burning equipment or portable attemps Diesel fuel/fuel oil:which feel tank or portable Diesel fuel/fuel oil:which feel tank or portable Diesel fuel/fuel oil:which feel tank or portable Natural GBS: alow leak, so evaluation as medical use Residential use Row of stores Enclosed mall Bus. & Residential Office use Office use Industrial use Military use Ast then Paint: free paint contains container Other: Special Manket actions required or spill > Signl., Other inventure use				
J Property Use* Structures	341 Clinic, clinic type infirmary 539 Nousehold goods, sales, repairs 342 Doctor/dentist office 579 Notor vehicle/boat sales/repair				
131 Church, place of worship 161 Restaurant or cafeteria 162 Bar/Tevern or nightclub 213 Elementary school or kindergarten 215 High school or junior high 241 College, adult education 311 Care facility for the aged 331 Hospital	361 Prison or jail, not juvenile 571 Gas or service station 419 X 1-or 2-family dwelling 599 Business office 429 Multi-family dwelling 615 Zlectric generating plant 439 Rooming/boarding house 629 Laboratoxy/science lab 449 Commercial hotel or motel 700 Manufacturing plant 459 Residential, board and care 819 Livestock/poultry storage(barn) 464 Dormitory/barracks 882 Non-residential parking garage 519 Food and beverage sales 891 Warehouse				
Outside 124 Playground or park 555 Crops or orchard 569 Forest (timberland) 807 Dutdoor storage area	936 Vacant lot 981 Construction site 938 Graded/care for plot of land 946 Lake, river, stream 951 Railroad right of way 1000 Lake NOT checked a Property Use code only if you have NOT checked a Property Use hox; 960 Other street Property Use 419 961 Highway/divided highway 11 or 2 family dwelling				
31 Dopen land or field	962 Residential screen, different NFIRS-1 Revision 03/11/99				

Case time test March 1996		
Note people involved Check this box and stiach Supplemental Towns (DTIRS-15) as messagery		Involved Business hare (if applicable) Area Code Phone Number
Local Option Check this box off Inc. Following the control of th	Ligame address as incident location. Then skip the three ouplicate address lines.	whor Prefix Street or Highway Street Type Suffix Set Office Box Apt./Suite/Room City Late Eip Code
The rest of this section. Chart Die Now 16	K2 Owner Spice as p	son involved?
The control of the co	The rest	this section.
Lessal Option Call for reported house explosion at 22 Manning Street. Upon arrival strong odor of natural gas, light smoke from first floor, "B" wall damage visible from exterior. Investigation found contents fire first floor and active fire in basement. One 1 3/4 line taken to basement to knock down fire. Ventilation of basement windows to allow products of combustion to escape. Hydrant line laid but not charged and Ladder 1 -stick to roof. Fans used for ventilation of first and second floor. RMLD and Keyspan called to scene. **Tification made to Marshall's Office for member of Investigation Team. Trooper Peter **Tamonte and Sergeant Peter Cummings responded. Detective Mike Saunders from RP responded. Investigation by Keyspan of houses in area had readings ranging from 2-27% gas. Readings taken in basement after fire extinguished, by crack in basement floor and plumbing drain, were 24 - 27% gas. Investigation of area of origin found that an explosion had occurred of natural gas ignited by gas furnace. Subsequent fireball and blast pressure traveled up basement staircase through first floor and up main staircase pushing out "B" & "C" walls of house. Interior walls damaged on first floor and ceilings on second floor due to blast. Moderate fire damage in basement, kitchen first floor and entrance hall. Mr. Gary Bennett, National Grid, was the field supervisor overseeing crews from Keyspan. Excavation found crack in 6" gas main in front of dwelling. State Police form Marshall's Office contacted Department of Public Utilities and Mr. Jorge Santi arrived on scene to Oversee crews from Keyspan and National Grid. Grews from Keyspan scene to Doversee crews from Keyspan and National Grid. Grews from Keyspan scene to Doversee of the output of the night with detail from RPD. Houses in the neighborhood would be checked hourly for readings by Keyspan. Unknown Staff Member **Signature** **Unknown Staff Member** **Discrete Member miching report ID **Signature** **Unknown Staff Member** **Discrete Member Miching repor	same address as incident location. Then skip the three duplicate address lines.	eber Prefix Street or Highway Street Type Suffix St Office Box Apt./Suite/Room City
call for reported house explosion at 22 Manning Street. Upon arrival strong odor of natural gas, light smoke from first floor, "B" wall damage visible from exterior. Investigation found contents fire first floor and active fire in basement. One 1 3/4 line taken to basement to knock down fire. Ventilation of basement windows to allow products of combustion to escape. Bydrant line laid but not charged and Ladder 1 -stick to roof. Fans used for ventilation of first and second floor. RMLD and Keyspan called to scene. rification made to Marshall's Office for member of Investigation Team. Trooper Peter ramonte and Sergeant Peter Cummings responded. Detective Mike Saunders from RP responded. Investigation by Keyspan of houses in area had readings ranging from 2-27% gas. Readings taken in basement after fire extinguished, by crack in basement floor and plumbing drain, were 24 - 27% gas. Investigation of area of origin found that an explosion had occurred of natural gas ignited by gas furnace. Subsequent fireball and blast pressure traveled up basement staircase through first floor and up main staircase pushing out "B" & "C" walls of house. Interior walls damaged on first floor and ceilings on second floor due to blast. Moderate fire damage in basement, kitchen first floor and entrance hall. Mr. Gary Bennett, National Grid, was the field supervisor overseeing crews from Keyspan. Excavation found crack in 6" gas mair in front of dwelling. State Police form Marshall's Office contacted Department of Public Utilities and Mr. Jorge Santi arrived on scene to oversee crews from Keyspan and National Grid, Crews from Keyspan stayed on scene throughout the night with detail from RPD. Houses in the neighborhood would be checked hourly for readings by Keyspan. Details of the server in the server is the server in the server in the server is the server in the server is the serve		by Edic
Taken in basement after fire extinguished, by crack in basement floor and plumbing drain, were 24 - 27% gas. Investigation of area of origin found that an explosion had occurred of natural gas ignited by gas furnace. Subsequent fireball and blast pressure traveled up basement staircase through first floor and up main staircase pushing out "B" & "C" walls of house. Interior walls damaged on first floor and ceilings on second floor due to blast. Moderate fire damage in basement, kitchen first floor and entrance hall. Mr. Gary Bennett, National Grid, was the field supervisor overseeing crews from Keyspan. Excavation found crack in 6" gas main in front of dwelling. State Police form Marshall's Office contacted Department of Public Utilities and Mr. Jorge Santi arrived on scene to oversee crews from Keyspan and National Grid. Crews from Keyspan stayed on scene throughout the night with detail from RPD. Houses in the neighborhood would be checked hourly for readings by Keyspan. L Authorization D238 Officer in Charge 1D Signature Jackson, Paul Darie Fosition or rank Assignment Month Day Fosition or rank Assignment Nonth Day Fosition or rank Nonth Day Fosition or rank Assignment Nonth Day Fosition or rank Nonth Day Fosition or rank Nonth Nonth Day Fosition or rank Day Fosition or rank Nonth Day Fosition or rank Nonth Day Fosition or r	Call for reported gas, light smoke found contents fi basement to knock to escape. Hydran rans used for ven ptification made camonte and Serger	rom first floor, "B" wall damage visible from exterior. Investigation e first floor and active fire in basement. One 1 3/4 line taken to down fire. Ventilation of basement windows to allow products of combustion line laid but not charged and Ladder 1 -stick to roof. ilation of first and second floor. RMLD and Keyspan called to scene. to Marshall's Office for member of Investigation Team. Trooper Peter ant Peter Cummings responded. Detective Mike Saunders from RP responded.
by gas furnace. Subsequent fireball and blast pressure traveled up basement staircase through first floor and up main staircase pushing out "B" & "C" walls of house. Interior walls damaged on first floor and ceilings on second floor due to blast. Moderate fire damage in basement, kitchen first floor and entrance hall. Mr. Gary Bennett, National Grid, was the field supervisor overseeing crews from Keyspan. Excavation found crack in 6" gas main in front of dwelling. State Police form Marshall's Office contacted Department of Public Utilities and Mr. Jorge Santi arrived on scene to oversee crews from Keyspan and National Grid. Crews from Keyspan stayed on scene throughout the night with detail from RPD. Houses in the neighborhood would be checked hourly for readings by Keyspan. L. Authorization D238 Officer in charge ID Jackson, Paul Jit Position or rank Assignment Month Day Year District Member making report ID Signature Jone Month Day Jone Month	taken in basement	eyspan of houses in area had readings ranging from 2-27% gas. Readings after fire extinguished, by crack in basement floor and plumbing drain,
Excavation found crack in 6" gas main in front of dwelling. State Police form Marshall's Office contacted Department of Public Utilities and Mr. Jorge Santi arrived on scene to oversee crews from Keyspan and National Grid. Crews from Keyspan stayed on scene throughout the night with detail from RPD. Houses in the neighborhood would be checked hourly for readings by Keyspan. [] Authorization D238	by gas furnace. Sthrough first flowalls damaged on	bsequent fireball and blast pressure traveled up basement staircase r and up main staircase pushing out "B" & "C" walls of house. Interior irst floor and ceilings on second floor due to blast. Moderate fire damage
Officer in charge ID Signature Description of rank Assignment Month Day Year Check Dox 2f	Excavation found office contacted loversee crews from the night with det	rack in 6" gas mair in front of dwelling. State Police form Marshall's epartment of Public Utilities and Mr. Jorge Santi arrived on scene to Keyspan and National Grid. Crews from Keyspan stayed on scene throughout ail from RPD. Houses in the neighborhood would be checked hourly for
Officer in charge 1D Signature Position or rank Assignment Month Day Year Check Box if Unknown Staff Member Land Box if L	L Authorization	
Sox E Position or rank Assignment Month Day Year serve se Officer Member making report 1D Signature		Position of rank Assignment Month Day Year
II Citelye:	Box #f	

9784524460

Jan 26 10 05:56p

Barry Gannon

460

p.3

17246 MA State &	MM DD YYYY 1 25 2010 Incident Date *	HQ 10-0000317 000 Exposure &	Complete Narrative
------------------	--	------------------------------	-----------------------

Narrative:

Tall for reported house explosion at 22 Manning Street. Upon arrival strong odor of natural gas, light smoke from first floor, "B" wall damage visible from exterior. Investigation found contents fire first floor and active fire in basement. One 1 3/4 line taken to basement to knock down fire. Ventilation of basement windows to allow products of combustion to escape. Hydrant line laid but not charged and Ladder 1 -stick to roof.

Fans used for ventilation of first and second floor. RMLD and Keyspan called to scene. Notification made to Marshall's Office for member of Investigation Team. Trooper Peter Bramonte and Sergeant Peter Cummings responded. Detective Mike Saunders from RP responded. Investigation by Keyspan of houses in area had readings ranging from 2-27% gas. Readings taken in basement after fire extinguished, by crack in basement floor and plumbing drain, were 24 - 27% gas.

Investigation of area of origin found that an explosion had occurred of natural gas ignited by gas furnace. Subsequent fireball and blast pressure traveled up basement staircase through first floor and up main staircase pushing out "B" & "C" walls of house. Interior walls damaged on first floor and ceilings on second floor due to blast. Moderate fire damage in basement, kitchen first floor and entrance hall.

Mr. Gary Bennett, National Grid, was the field supervisor overseeing crews from Keyspan. Excavation found crack in 6" gas main in front of dwelling. State Police form Marshall's Office contacted Department of Public Utilities and Mr. Jorge Santi arrived on scene to oversee crews from Keyspan and National Grid. Crews from Keyspan stayed on scene throughout the night with detail from RPD. Houses in the neighborhood would be checked hourly for eadings by Keyspan.

House occupies at time of incident by:

was admitted to Winchester Hospital for observation of chest pain, report attached.

17246 01/25/2010 10-0000317

A 17246 MA 01 25 2010 Store & Incident Date &	HQ 10-0000317 Incident Nurber *	Delete Dollete Onange Exposure & Do Activity Delete NFIRS -2 Fire
B Property Details O002	or Products Enter up to three codes. Check one or more boxes for each code entered. On-site exterial (1)	ownlete if there were any significant counts of commercial, industrial, energy or ricultural products or materials on the operty, whether or not they became involved Bulk storage or warehousing Processing or manufacturing Packaged goods for sale Repair or service
B2 O01 Buildings not involved Number of buildings involved B3 None Acres burned (outside fires) Less than one acre	On-site reterial (2)	Bulk storage or warehousing Processing or manufacturing Reckaged goods for sale Repair or service Bulk storage or warehousing Processing or manufacturing Reckaged goods for sale Repair or service
In 162 Heating room or area,	Cause of Ignition Check box if this is an exposure report. skip to section 6 Intentional X) Unintentional	E3 Human Factors Contributing To Ignition Chack all applicable boxes 1 Asleep None 2 Possibly impaired by
D2 10 Heat from powered 5 Heat source *	Failure of equipment or heat source Act of nature Cause under investigation Cause undetermined after investigati actors Contributing To Ignit	6 Divisions persons involved
Iten first ignited & I Check Box if fire spread of prigin D4 11 Natural gas Type of raterial haddied only if item first	23 Leak or break Nation Contributing To Ignition (2)	One 7 Nage was a factor Estimated age of person envolved 1 Nale 2 Penale
None if Equipment was not involved, Skip to section G	Natural gas or Ent	e Suppression Factors er up to three codes. None
Brand Nodel Serial f Doved by be use	Portable Nationary e equipment normally can be yone person, is designed to	pression factor (2)
H ₁ Mobile Property Involved H ₂ Mobile		Local Use [Pre-Fire Plan Available some of the information presented in this report may be based upon reports from other Agencies [Arson report attached [Police report attached [Coroner report attached [Other reports attached]
Noblie property model License Place Number State VIN Number	Year	NFIRS-2 Revision 01/15/99

Il Structure Type * refrire was In enclosed building or a portable/mobile structure complete	I2 Buildi	ng Status *		uilding * eight	I4 Main Floor S	Structure
the mest of this form	1 Under co	nstruction		ROOF as part		Pire
1 X Enclosed Building	H-mark	& operating				8 9•¥
2 Portable/mobile structure 3 Popen structure	3 Tale, no	t routinely used	L 0	02	[001 ,	400)
Air supported structure		jor renovation		umber of stories bore grade	Total square feet	-
5 Tent	5 Vacant a			1	OR	
6 Open platform (e.g. piers)	7 Deing de	CHARLE PROPERTY AND SOCIAL PROPERTY SAFETY	-	Ol		
7 Underground structure (work areas) 8 Connective structure (e.g. fences)	ODother	To American Discussion Sec. 15.	belov gr		,050 B	
0 Other type of structure	U Undeterm	ined	•		Lenght in feet	Width in feet
Ja Fire Origin * J3		per of Stori		100	erial Contributi Plame Spread	ng Most
001 Below Grade Con		part of the hig			if no flame spread	Skip To
	001 Number of	stories w/ minor de flame damage)	PAG:	OR un	me as material first ignite able to determine	DECTION D
J2 Fire Spread *		stories w/ signific flams damage)	ant demage	K1 65	Flammable li	The second secon
2 Confined to room of origin	1,000,000	stories w/ heavy da flame damage)	nage	K2 11	Natural gas	1
3 Confined to floor of origin 4 X Confined to building of origin	*	W Sees	24		f material contributing	Required only if item
5 Beyond building of origin	The state of the s	stories v/ extreme (ianage			code is 00 or<70
L1 Presence of Detectors *	L3 Dete	ctor Power S	upply :	712	ector Effectiven	
(In area of the fire) Skip to	7 2 DBatt	ery only		Regu	ired if detector ope	erated
N None Present section M		wire only	1	1 hlerte	d Occupants, occupan	nts responded
1 X Present	3 DPlug				nts failed to respon	nd
U Undetermined		wire with batter in with batter			were no occupants to alert occupants	
	6 Mech		550 11 1	U Undete		
T ₁ 2 Detector Type	7 Mult	ple detectors &		L6 Dete	ctor Failure Re	0.000
X Smoke	-	r supplies			if detector failed	300000000000000000000000000000000000000
2 Neat	U Dunde					
3 Combination smoke - heat	L4 Dete	ector Operat	ion	=	failure, shutoff or er installation or p	a l
4 sprinkler, water flow detection	1 1 1	ire too small		3 Defect		
23.	1	to activate			of maintenance, incl	-1-11-11-11-11-11-11-11-11-11-11-11-11-
5 Nore than 1 type present		perated Complete Section	L5)		y missing or discon y discharged or dead	
O Other		ailed to Opera	te	0 Other		
Undetermined □		Complete Section Indetermined	Бел	U Dundete:	mined	
M1 Presence of Automatic Extinguishmen	nt System *	M3 Automatic	Extingu	ishment	M5 Automatic Ext	inguishment
N None Present	•	System Op Required if fire w		esigned rance	System Failux Required if syste	
The state of the s	te rest	1 Doperated	effect	ive (Go to M	1 Devetam shut of	
M2 Type of Automatic Extinguishment	Bystem *	2 Doperated a			2 Not enough age	nt discharged
Required if fire was within designed r	ange of AES	4 Failed to			3 Agent discharg	
1 Met pipe sprinkler 2 Mory pipe sprinkler		0 Other		8	not reach fire	
3 Other sprinkler system		U Undetermin	ed		5 Fire not in ar	11.9
4 pry chemical system		M4 Number of	Sprinkl	er	6 System compone	- English Advisor - Company
5 Poam system		Heads Ope		*	7 Dack of mainte	C CONTRACTOR
6 Halogen type system 7 Carbon dioxide (CO2) system		Required if s	ystem opez	rated	8 Manual Interve	ntaon
O Other special hazard system				75 H	U Undetermined	
U Undetermined		Number of spr.	inkler hea	ade operating	NFIRS-3 Revisi	on 01/19/99

	MM DD Y MA 1 25 Lete * Incident Date *	YYY 2010	HQ Station		-0000317		elete Apparatus or Resources
B Apparatus or * Resource	Check if same as	alarm date	Hour Kin	Sent X	Number of * People	Use Check ONE box for each apparatus to indicate its min use at the incident.	Actions Taken
1 ID C1	Dispatch	2010	18:05 18:09 22:30	X		XSuppression □EMS □Other	
2 ID E1	Dispatch X 1 25 Arrival X 1 25 Clear X 1 25	2010	18:01 18:04 23:07	X	0	X Suppression EMS Other	
3 ID E2	Dispatch 1 25 Arrival 1 25 Clear 1 25	2010	18:01 18:04 23:07	X	<u></u> 0	Suppression EMS Other	
4 ID L1 Type 12	Dispatch	2010	18:01 18:04 23:07	X	0	X Suppression BMS Other	
5 ID [P1 Type 76	Dispatch	2010	18:01 18:04 23:07	x	· [0]	Suppression EMS Other	
fype	Dispatch Dis					Suppression Other	
7 ID	Dispatch					Suppression MRS Other	
Type	Dispatch Arrival Clear					Suppression EMS Other	
9 ID	Dispatch					Suppression BMS Other	
Type of Apparatus Ground Fire Suppres 11 Engine 12 Truck or aerial 13 Quint 14 Tanker & pumper co 16 Brush truck 17 ARF (Aircraft Reso 10 Ground fire suppres 10 Dozer or plow 22 Tractor 24 Tanker or tender 20 Heavy equipment, of Aircraft 41 Aircraft: fixed with 42 Helitanker 43 Helicopter	emion combination cue and Firefighting) ession, other ment	51 Fi 52 Bo 50 Ma Suppo 61 Br 62 Li 60 Su Medic 71 Re 72 Ur 73 Hi 75 BL	e Equipme re boat wit at, no pump rine apparent Equipm eathing apport and air pport apparent Equipment apparent ban Search gh angle resunit sunit sical and result an	th pump atus, o ent paratus c unit ratus, ue & resc escue u	ther support other ue unit	Other 91 Mobile co 92 Chief off 93 HazMat un 94 Type 1 ha 95 Type 2 ha 99 Privately 00 Other app NN None UU Undetermi	mmand post. icer car iit nd crew nd crew cowned vehicle aratus/resource
40 Aircraft, other							

Jan 26 10 05:50p		Daily Cal	1111011						-			
A 17246	M.	A	MM D	5 :	777 2010	HQ Station		-000031		000	Delete	IRS - 10 exponnel
			Date	and Ti	mes		Sent	Number		Use	Action	s Taken
B Apparatus or	*			same as al				of *	Check	ONE box for each	List up to	4 actions
Resource						Hours/mins	x	People	its m	ONE box for each	and each ;	ersonne.
Use codes listed belo				h Day							i	1 1 1
1 ID C1	- 1	Dispatch		25	2010		Sent	. 1 61	-	Suppression EMS		
	_	Arrival		25	2010		X	0		Other		
Туре 92		Clear	X):	25	2010	22:30			T L.	Jener	_	
			Name	.		Rank or	Atten	d Act	lon	Action	Action	Action
Personnel ID						Grade	x	Tak	en	Taken	Taken	Taken
45	1											
											-	
	1							1				
	1											
	1											
* =							\Box					
											1	
										14		
	1	Dispatch	ומו	1 25	2010	18:01	Sent		IX	Suppression	1 1	111
2 ID El		Arrival	10.00	1 25	2010	ALL AND THE PROPERTY OF THE PR	X	1 0	_	ems		
Type 11	- 1	Clear		25		23:07				Other	L	با لـ
- 7.	1-1	CTEGT	RE L				Atten	d >		Action	Action	Action
Personnel	1		Name)		Rank or	<u> </u>	a Act:		Taken	Taken	Taken
ID						Grade	x	, 200	C11	1		
	├				_			1				
										İ		
*												
]		
											-	
										1		
	1						=:					
2											5	
	1-		Befor 1	11 0=11	2016	0 18:01	Sent	T	100	Suppression	1	111
3 ID E2	- 11	Dispatch		25		0 18:04	X	1 01		EMS		
	- 1	Arrival		25		0 23:07	الثا ا	1 -0		Other	L	
Туре 11		Clear	X _ :	25	2011	N 50.01						1,000
Personnel	199		Name	2		Rank or	Atten	1.00	ion	Action	Action	Action
ID						Grade	x	. Tal	cen	Taken	Taken	Taken
	-									,		
				3			1					
							2.					
							İ					
												*
	1											
]											
	-											

Jan 2	0 10 00100							
A	17246	MM DD YYYY MA 1 25 2010 State * Incident Date *	HQ		-000031°		Inelete	FIRS - 10 execunel
1	pparatus or Resource	Check if same as alarm date	Hours/mins	Sent	Number of * People	Use Check ONE box for each apparatus to indicate its main use at the incident.	ı	o 4 actions apparates personnel.
1	ID L1	Dispatch 1 25 2010 Arrival X 1 25 2010 Clear X 1 25 2010	0 18:01	Sent X	0	Suppression EMS Other	L	
	Personnel	Name	Rank or Grade	Attend	d Acti Take		Action Taken	Action Taken
			3					
2	ID P1	Arrival X 1 25 2010	18:01 0 18:04 0 23:07	Sent X	0	X Suppression BMS Other		
,	Personnel ID	Name	Rank or Grade	Attend	Take	STANDARD OF STANDARD STANDARDS	Action Taken	Action Taken
z.								
3	ID	Dispatch		Sent	Ш	Dother Calculation		ا ا ا ا
P	Personnel	Name	Rank or Grade	Attend	Acti Take		Action Taken	Action Taken
•								

p.10 9784524460

Jan 26 10 05:59p Ban	ly Gaillon			**	
17246 MA	1 25 L Incident Date	2010 HQ Station	10-0000317	Exposure	Responding Units/Personnel
Unit		Notify Time	Enroute Time	Arrival Time	Cleared Time
Chief		18:05:00	18:07:00	18:09:00	22:30:00
Staff ID\Staff Name		Activity	Rank	Position	Role
Starr as la		W		9	-
El Engine l		18:01:00	18:01:00	18:04:00	23:07:00
Staff ID\Staff Name	27 JE	Activity	Rank	Position	Role
Stall ID(btdl2 ham					
E2 Engine 2		18:01:00	18:01:00	18:04:00	23:07:00
Staff ID\Staff Name		Activity	Rank	Position	Role
	•				
Ll Ladder 1		18:01:00	18:01:00	18:04:00	23:07:00
Staff ID\Staff Name		Activity	Rank	Position	Role
		•			
Pl Paramedic l	SP x	18:01:00	18:01:00	18:04:00	23:07:00
Staff ID\Staff Name		Activity	Rank	Position	Role
			*	. 1	•

10-0000317 01/25/2010 27246

1

EXHIBIT 3

National Grid Report on its Investigation of the Incident

Information Request PL 1-2

Respondent: V

William Mycroft

Request:

Provide a sequence of events and a description of the Incident. Include all records that demonstrate: (1) the time National Grid was notified of the Incident; and (2) when Dispatch notified the leak responder, crew and supervisor(s) to report to the Incident. Include in your response documentation on their arrival times; and when National Grid initiated an Emergency Notification to staff.

Response:

January 25, 2010

18:06 - Reading Fire Department contacts company to notify of a possible disturbance.

18:07- CMS technician dispatched at 18:07

18:10 - MSF Supervisor R. Elmstrom notified.

18:20 - First company notification sent out - "Special Notification - Possible Disturbance - 228 Pleasant St, Reading MA - National Grid MA/NH - Report of a possible disturbance from Reading fire department.

18:20 - CMS Supervisor M. Verrell notified

18:30 - MSF Supervisor R. Elmstrom arrived

18:34- CMS technician arrived on site

18:45- CMS Supervisor M. Verrell arrived

18:57 - Second notification goes out - "UPDATE: Abnormal Event - Disturbance - 228 Pleasant St, Reading MA - UPDATE: On scene supervisor reports structural damage to one family house. Inside fire contained by fire department. Gas service interrupted by fire department prior to company arrival. Community Relations notified. Media Relations notified. Gas control notified. Supervisor requesting odorant levels check in the area.

19:08 - MSF crew dispatched to site.

20:00 - D.P.U. notified.

21:00- D.O.T. notified

MASSACHUSETTS DEPARTMENT OF PUBLIC UTILITIES GAS NOTIFICATION FOLLOW-UP REPORTING FORM - Page 2 of 2

INCIDENT DATE:

01/25/10

REPORT DATE: 01/25/10

OPERATOR: National Grid

LOCATION: 228 Pleasant St., Reading

INJURIES/FATALITIES:

EMERGENCY RESPONDERS: N/A

OPERATOR PERSONNEL:

N/A

GENERAL PUBLIC:

Two individuals treated for non serious injuries.

CAUSE(S) (Check all that apply):

THIRD PARTY DAMAGE ____ (Separate Dig Safe Report required, MGL c.82, s.40)

CORROSION EQUIPMENT FAILURE ____ MATERIAL FAILURE

PERSONNEL ERROR _____ CI JOINT LEAK ____

OTHER (Explain)

DPU TELEPHONIC NOTIFICATION:

DATE: 01/25/10

TIME: 20:00/20:05

REC'D. BY: Richard Wallace

(voicemail/spoken to)

PHMSA NOTIFICATION: (If applicable)

DATE: 01/25/10

TIME: 21:00

REC'D. BY: Mrs. Arsenault

D.O.T. #929643

DESCRIPTION: (Include applicable information such as number of people evacuated and duration of evacuation; injuries; estimated damage to operator's facilities and other's persons' property; work being done by operator; work being done by others; depth of facility; etc. Use additional sheets of paper, if necessary)

National Grid received report of possible explosion from Reading Fire Department. Company responded and arrived at approximately 18:37. The gas service had been shut off by fire department prior to National Grid's arrival. Two individuals were treated for non serious injuries. Substantial property damage to residence reported. Company found cracked 6 inch cast iron main in street in front of 22 Manning Street.

MASSACHUSETTS DEPARTMENT OF PUBLIC UTILITIES GAS NOTIFICATION FOLLOW-UP REPORTING FORM – Page 1 of 2

INCIDENT DATE:	01/25/10		REPORT DATE: 01/25/10
GAS OPERATOR:	National Grid		
PERSON REPORT	ING: Victor Santana		PHONE #: 781-466-5484
LOCATION:	228 Pleasant Street, Mas	sachu	setts
NOTIFIED BY:	Reading Fire Departmen	t	
OCCURRED AT:	am	18:06	pm
NOTIFIED AT:	am	18:06	pm
FIRST ARRIVED A	Γ: am	18:37	pm
MADE SAFE AT:	am	18:37	pm (prior to company arrival)
INCIDENT TYPE (C	heck all that apply):		
GAS ODOR	GAS LEAK CO_		
OUTAGE #	OF CUSTOMERS AFFEC	CTED:	DURATION:
EVACUATION	x # OF PERSONS:	3	DURATION:
UNDER-PRESSU	RIZATION: OVER	-PRES	SURIZATION
FIRE: EX	PLOSION: _X		
OTHER (Explain):			
FACILITIES INVOL	VED (Describe all that ap	ply):	
MAIN(S): SIZE: SIZE:	6" MAOP: 2 psig" MAOP: psig		MATERIAL: Cast Iron MATERIAL:
SERVICE(S): SIZE: SIZE:	" MAOP: " MAOP:	psig _psig	MATERIAL:
CUSTOMER FACILI	ΓΥ (Describe):		a 2
OTHER (Describe):			

Incident Analysis Report

national**grid**

Incident ID:

59442

Incident Summary (1984) No. 1 (1984) West of an incident to the comment of the control of the co

Incident Type:

Near-Miss, Public Incident

Employee Name:

Scaparotti, Mark

Incident Date/Time:

1/25/2010 6:30 PM

Incident Location:

22 Manning Street, Reading MA

What Happened:

A gas disturbance occurred at 22 Manning Street in Reading, Mass. Gas leak, grade 1.

Additional Notes:

(NOTE: This IA has attachment(s).)

Incident Analysis

Investigation Status: Investigation Closed

Due Date: 03/16/2010

Complete Date:

03/12/2010

Contributing Factors & Action Plan

Engineering Fectors - Inspequate or poor design	Examine algorithm used to prioritize mains for replacement.	McPhillips,lan R	3/1/10	2/3/10
Human Factors - Communication Issues	Confirm when bill inserts explaining how to recognize and report gas leaks went to customers in Reading. Confirm when the scratch and sulff cards were mailed to Reading customers.	Burnham,Michael S	3/1/10	2/26/10
Nork Environment Factors - Uncontrolled Work Environment Factors - Uncontrolled - Proximity to other utilities	Investigate origins of unknown patch and determine, if possible, who created it.	Scaparotti,Mark A	3/1/10	2/5/10

Lessons Learned

4	÷	
٠	î	
ż	,	

Type	Name	Title	Phone
IA Team Leader	Drower, Philip	Manager	631-755-4867
IA Team Member	Aronson, Christopher	Senior Counsel I	781-907-1854
IA Team Member	Burnham, Michael	Sr Safety Rep	401-335-8680
IA Team Member	Distefano, John	Lead Engineer	516-545-3376
IA Team Member	Gallinaro, Michael	Lead Project Manager	718-963-5577
IA Team Member	Scaparotti, Mark	Manager	-
IA Team Member	Shapiro, Arthur	Principal Engineer	516-545-3837
IA Team Member	Zerelle, Michael	Manager	516-545-4737

Exhibit PL-1-1

Incident ID: 59442

Dépa	rtments/Areat	for Communication Purposes
	All Department Construction & Facilities Gas Meter OH Stores Substation Transportation UG	Maintenance Services
Team		
Review	the analysis ar	nd improvement action plan and ask the following:
Comm	unication	Do communication plans clearly indicate who will communicate, what will be communicated, and how it will be communicated?
Clarity		Is the root cause/contributing factors clearly identified?
Root C	ause	Does the improvement plan identify and address the root cause of the incident?
Risk R	eduction .	How effective will the implementation of the action items be in reducing the risk of recurrence?
Respo	nsibility	Are the individual action plans property assigned?
Retrain	ing	is the employee involved in the incident receiving appropriate retraining, if applicable?
Due Da	tes	Are the action item due dates reasonable? How will follow-up before the due date be performed to ensure the item can and will be addressed?

Appendix List of Available Contributing Factors		GARAGES.	-Aller	rittiği d	: ·
Engineering Factors					
Drawing/specification or data error					
Error in equipment or material selection					
Inadequate or poor design				*	
1.00	*	27			
Equipment/Tools/Materials Factors					
Defective or failed part/material					
Error by manufacturer in shipping/marking					
inadequate inspection and maintenance					
Incorrect selection					
Incorrect use					
Poor condition					*
Golden Ruic Violations					
Fall Prevention					
Operation of Vehicles					
Permits and Authorizations			ě		
Personal Protective Equipment					
Safety Protection Systems and Devices					
Underground Services					
Work Area Control		3			
Human Factors					
Communication issues					
Job brief/risk assessment					
Unclear expectations					
Verbal communication problem					
Work area.protection (signs/tags/demarcation etc.)					
Data Issues					
EMS update					
Mapping error					
Did not follow procedures/work practices/instructions/rules Accepted practice caused a failure to follow procedure or instruction					
Improper switching order					
Inadverient error					
Inattention to detail					
Incomplete research		* .			
Misinterpretation					
Operated wrong device					
Order upe not followed					

59442

Fatigue/iliness
Inadequate knowledge/training
Inadequate content of training
Insufficient practice or hands-on experience
Insufficient refresher training
No training provided
Inadequate PPE
Body · Fire retardant clothing
Body - High visibility clothing
Eyes
Fall protection
Feet
Hands
☐ Head
Hearing
Respiratory protection
Rubber gloves/sieeves
Management issues
Company culture/leadership issues
improper resource allocation
Inadequate administrative controls (procedures/policies/standards)
Inadequate communication of procedures/policies/standards/phorities
Inadequate employee selection/placement/qualifications
Inadequate supervision - Experience/development
Inadequate supervision - Knowledge/training
Inadequate supervision - Leadership
Inadequate supervision - Time/resources
Work organization or planning deficiencies
Motor Vehicle/Equipment Operation
Avoidance of another vehicle or object
Driving/traffic rules not followed
Encroachment of minimum approach distances
Inadequately secured load
Inappropriate operation of equipment
Inattention/distraction
Unawareness of changing weather and road/driving conditions
Poor body positioning
Work Environment Factors
Controlled
Housekeeping
Inadequate work area protection
Incorrect management of hazardous aubstances/almospheres
Site preparation

Incident ID:	

59442

		Work pace
П	Unco	ontrolled
-		Condition of terrain
		Dense population
		Other (describe below)
		Proximity to other utilities
	n	Weather conditions

Incident that occurred January 26, 2010, at 22 Manning Street in Reading Mass.

PRIVILEGED AND CONFIDENTIAL ATTORNEY COMMUNICATION

[Note: As of February 5, this incident has not been entered into IMS]

Description

At 6:30 p.m. on Monday, January 26, 2010, National Grid received notification of a disturbance at 228 Pleasant Street in Reading, Mass. The actual address turned out to be 22 Manning Street in Reading.

According to the Reading Fire Department, the fire occurred in the basement of the home. The second floor of the house sustained significant damage, including bowed walls, and the first floor sustained minor damage.

Readings taken about 7 p.m. showed 100 percent gas in sewer manholes on both sides of the house, minimal readings at the water service, and 1 percent gas across the street. Observations at the site were consistent with the assumption that gas reached the basement by flowing along a sewer pipe.

At 9 p.m., National Grid workers exposed a six-inch cast iron main carrying gas pressurized at two pounds. The main was broken, but not completely severed. National Grid employees were asked not to install new pipe until officials from the Massachusetts Department of Public Utilities arrived on site to inspect the old pipe. At 9:50 p.m., the old pipe had been inspected and a clamp was installed. Workers cut out the clamp on the broken main (for analysis), dug out a nearby Grade 3 leak, pressure-tested the service at 22 Manning Street, and cut off the service. The frost line was approximately twelve inches below the surface.

Pleasant Street and Manning Street in Reading were last surveyed by a National Grid leak crew on May 4, 2009. On December 2, 2009, a Grade 3 leak on 217 Pleasant Street was re-checked (according to Mapquest, the driving distance between 217 Pleasant Street and 22 Manning Street is .05 mile, or 264 feet). The homeowner told members of the fire department that he smelled gas in his basement about an hour before the disturbance but did not call anyone to report it; National Grid was not notified about the leak that contributed to the disturbance until after the disturbance had occurred.

There was no recent construction in the street. The only DigSafe on file was for a water main call conducted in 2002, but the water main is believed to be on the opposite side of the street from the gas main. A road patch in the general vicinity of the gas main was observed by National Grid workers — who judged it to be an old patch because of the significant amount of sinkage — but its origins remain unknown.

Root Cause Discussion

Once a timeline of events was established and the facts pertinent to the incident were put forward, a discussion of root causes took place. The discussion addressed seven general categories: procedures, training, quality control, communications, management systems, human engineering, and work direction. Concerns were raised about quality control, communications, and possibly training and human engineering:

Quality control – It was stated that the Malden area has more main breaks than any other National Grid region in New England, with approximately 35 in the last year. Team members asked how mains are identified for replacement, and were told an algorithm is used that considers the age of the pipe, the number of leaks per mile, the levels of each known leak on the main, and several other factors. The main that contributed to the 22 Manning Street disturbance was not on the list to be replaced; once the disturbance occurred, however, the main was placed on the list. Discussion ensued about whether the algorithm – or any algorithm – can and should predict every disturbance. Ian McPhillips volunteered to examine the algorithm, describe all its components, and do a general evaluation of its effectiveness in assigning priority to main replacements.

Communications – The homeowner smelled gas but did not report a gas leak either to National Grid or to the local fire or police departments. This raised the question about communications with homeowners. General sentiment among team members was that a flyer describing how to detect and report a gas leak had been included as a mailer in a recent billing. Mike Burnham volunteered to find out what the communication was, when it went out, and whether, as believed, it included customers in Reading.

Training and Human Engineering – These concerns related to the origin-unknown patch on the street. If the origin can be determined, the next step will be to establish who served as the Foreign Opening Inspector (FOI) during the work, what that person's training was (and should have been), and what human performance or human engineering factors may have influenced him or her during the task. Mark Scaparotti volunteered to continue researching the origin of the street patch and employees who may have been associated with it as FOIs.

State Fire Marshal Report

Fire Investigation Summary Report

Case Number: 2010-117-0249

Controlling Case Number: None

V,

Case Type: F52 Fire - Post Blast/Residential

Report Creator: Peter D Bramante

Lead Investigator(s): Peter D BRAMANTE Team: North

FIU Requested By: Lt Paul Jackson from Reading Fire Department

FIU Requested On:

Date and Time of Incident: 01/25/2010 at approximately 18:40 PM

Address/ Location of 22 Manning St Reading, MA

Incident:

Property Investigated

Type of Investigation: Explosion Type of Property: Residential

Protection Systems:

Smoke Detector: Operational

Comments: 2 1/2 story wood frame structure with pitched asphalt shingle roof , wood clapboard

siding and poured concrete foundation with full basement . 1 1/2 story in-law apartment attached to D side of structure . A side entrances to both the house

(concrete landing) and in-law apartment (wooden steps). B side wooden steps to first floor (kitchen) at B/C corner. No entrances on C side , with three A/C units on ground .

D side bulkhead to basement . Electric drop on second floor B /C corner. Electric

stove in main residence.

Fire Source

Cause of Fire: Accidental

Ignition: Most probable ignition source from gas heating system

Material Ignited: Natural gas; Class A common combustibles: wood, plastics, papers

Explanation:

On the above date and time, I was contacted by Trooper Sheryl O'Donnell of the Massachusetts State Police Fire and Explosion Investigation Unit regarding a request by the Reading Fire Department to assist with an origin and cause investigation at a house explosion at 22 Manning Street in Reading, MA. Upon arrival, I was met by Reading Fire Lt Paul Jackson outside the house. Also on scene were Reading Fire Chief Greg Burns, and Reading Police Detective Mike Saunders. During the scene examination, we were joined by Massachusetts State Police Sgt Peter Cummings, National Grid Director of Field Operations Gary Bennett, and Jorge Santi and Robbie McCabe, both members of the Massachusetts Department of Public Utilities. The house explosion had also caused a fire in the basement, which had been suppressed. Minor overhaul operations had been conducted to check for fire spread.

The building was a 2 1/2 story wood frame structure with a pitched asphalt shingle roof, wood clapboard siding and a poured concrete foundation with a full basement. There was also a 1 1/2 story in-law apartment attached to the D side of the structure. There were two entrances on the A side of the house, with one to the main house (concrete landing), and one to the in-law apartment (wooden steps). On the B side there were wooden steps to first floor (kitchen) at the B/C corner. There were no entrances on the C side, with three A/C units on the ground. There was a bulkhead entrance to the basement on the D side. the electric drop was located on the second floor B/C corner. There was an electric stove located in the kitchen of the main residence. A gas-fueled heating system was located in the basement along the center of the C wall. There were two sewer line cleanouts in the basement with one located beside the furnace along the C wall, and the second cleanout located along the center of the A wall. There was also a crack in the concrete slab in the basement, running from the center of the A wall to the center of the C wall.

Fire Investigation Summary Report

The kitchen door to the basement was blown into the kitchen. A pocket door separating the living room from the in-law apartment had been blown into the in-law apartment, along with part of the wall adjacent to the pocket door. On the second floor, the B wall was beveled out at the floor. The entire ceiling on the second floor had been displaced upwards due to the deflagration. The most likely point of ignition was believed to be the gas-fueled furnace located in the basement. High natural gas readings were recorded by National Grid workers in the basement after the fire and explosion. Also, multiple witnesses stated that there had been natural gas odors in the neighborhood for years. National Grid also stated there was an existing Level 3 leak in the area for some time.


As a result of our scene examination, coupled with witness interviews, it is my opinion and the collective opinion of the other investigators with whom I worked, that the cause of this fire was accidental. Further, we opine that in all probability the cause of this explosion and subsequent fire was a migration of gas vapors from a cracked six-inch gas main on the street through the soil and into the basement. The vapors most likely entered the basement through the two sewage drain lines as well as the crack in the basement floor. The most likely ignition source, as stated previously, was the furnace located in the basement. All other possible sources of accidental ignition were eliminated. Further, there is no evidence to suggest or information to indicate that this fire was intentionally set. Case closed.


Evidence
No Evidence
Photos
Taken By: Police Department
Description / Explanation / Comments: Det. Mike Saunders
K-9
K-9 Not Used
Occupants
Strandherg Thomas J 22 Manning St Reading, MA 00000
Strandberg, Deborah 22 Manning St. Reading, MA 00000 SSN: Unknown, Phone: Unknown
Strandberg, Mildred 22 Manning St Reading, MA 00000 SSN: Unknown, Phone: Unknown
Injuries
Strandberg, Deborah 22 Manning St Reading, MA 00000 SSN: Unknown, Phone: Unknown, Injury Status: Injured Occupant
Strandberg, Mildred 22 Manning St Reading, MA 00000 SSN: Unknown, Phone: Unknown, Injury Status: Injured Occupant
Owner


Fire Investigation Summary Report


Strandberg, Thomas J 22 Manning St Reading, MA 00000
Reported By
Strandberg, Thomas J 22 Manning St Reading, MA 00000
Powers, Chris - 235 Pleasant St Reading, MA 00000
Discovered By
Strandberg, Thomas J 22 Manning St Reading, MA 00000
Witnesses
Strandberg, Thomas J 22 Manning St Reading, MA 00000
Strandberg, Deborah — 22 Manning St Reading, MA 00000
Strandberg, Mildred — 22 Manning St Reading, MA 00000
Powers, Chris - 235 Pleasant St Reading, MA 00000
Donovan, Russell Pleasant St Reading, MA 00000

Photographs of the Incident

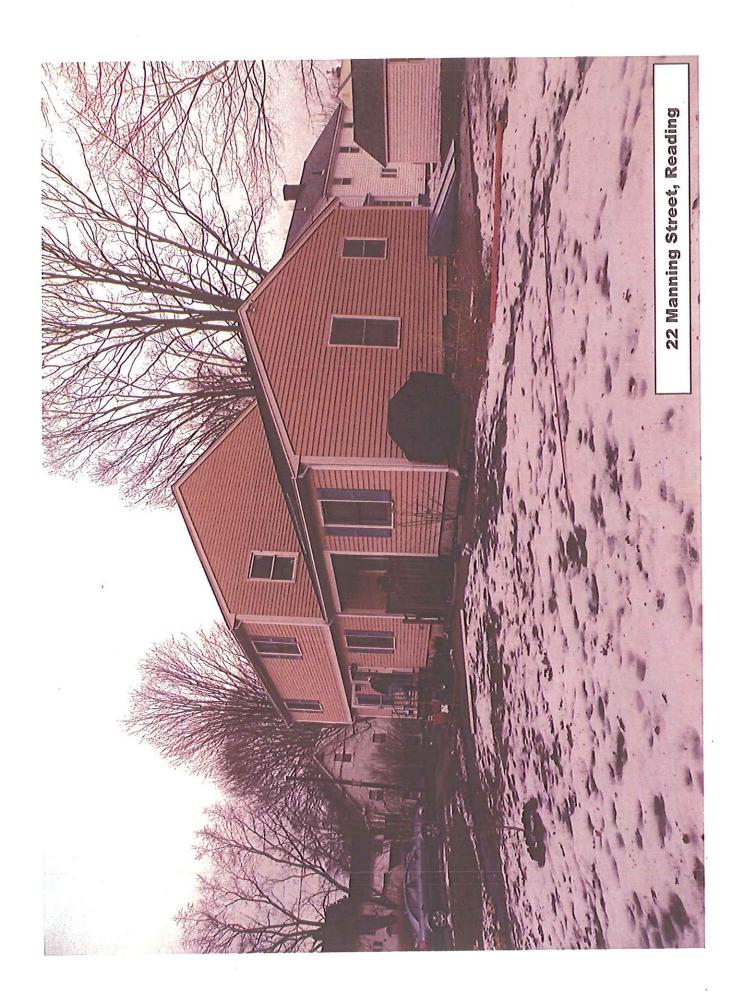

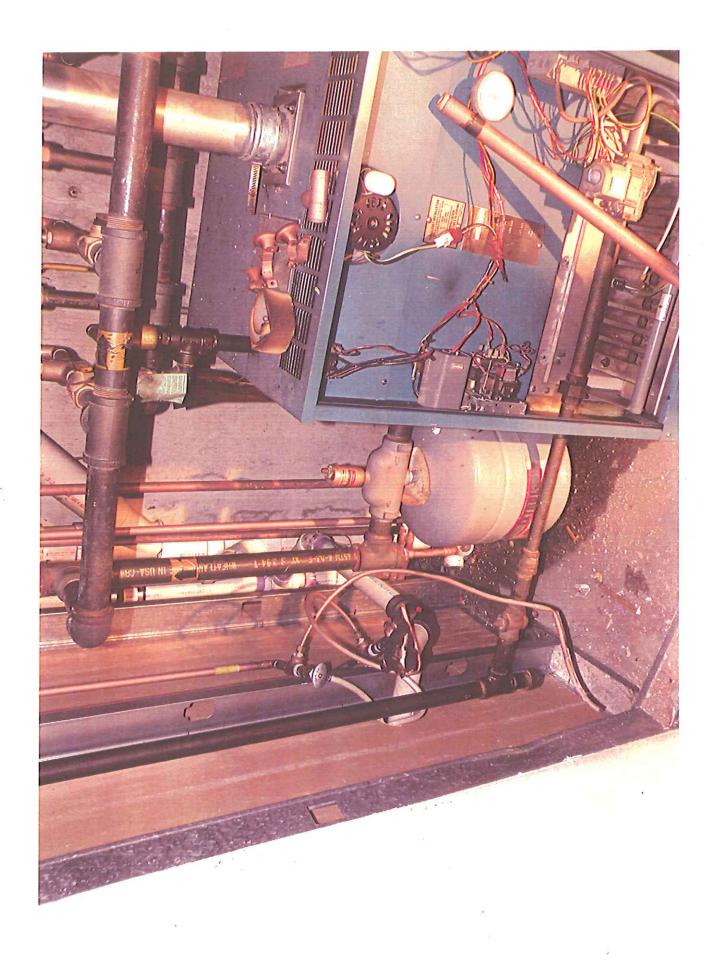

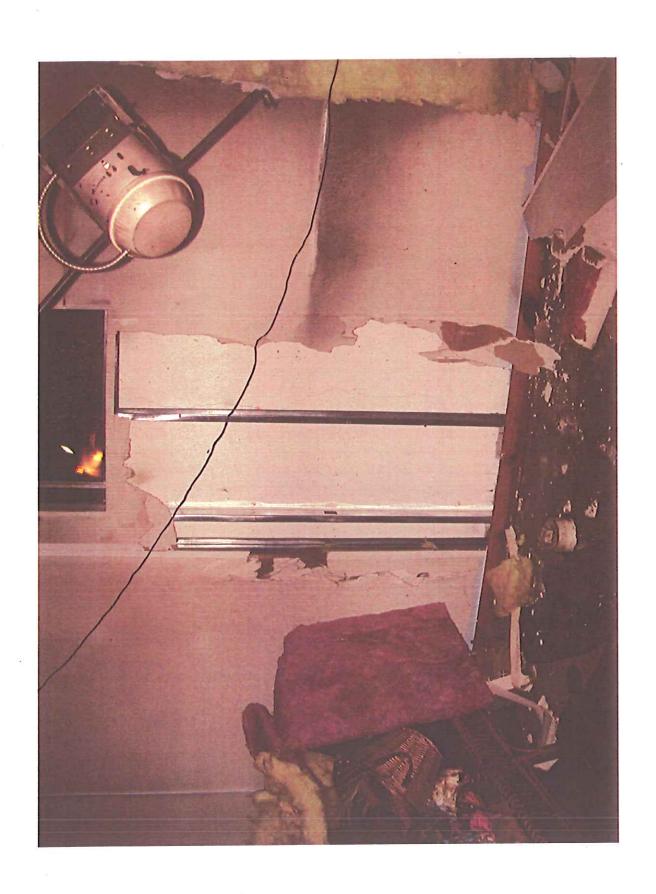

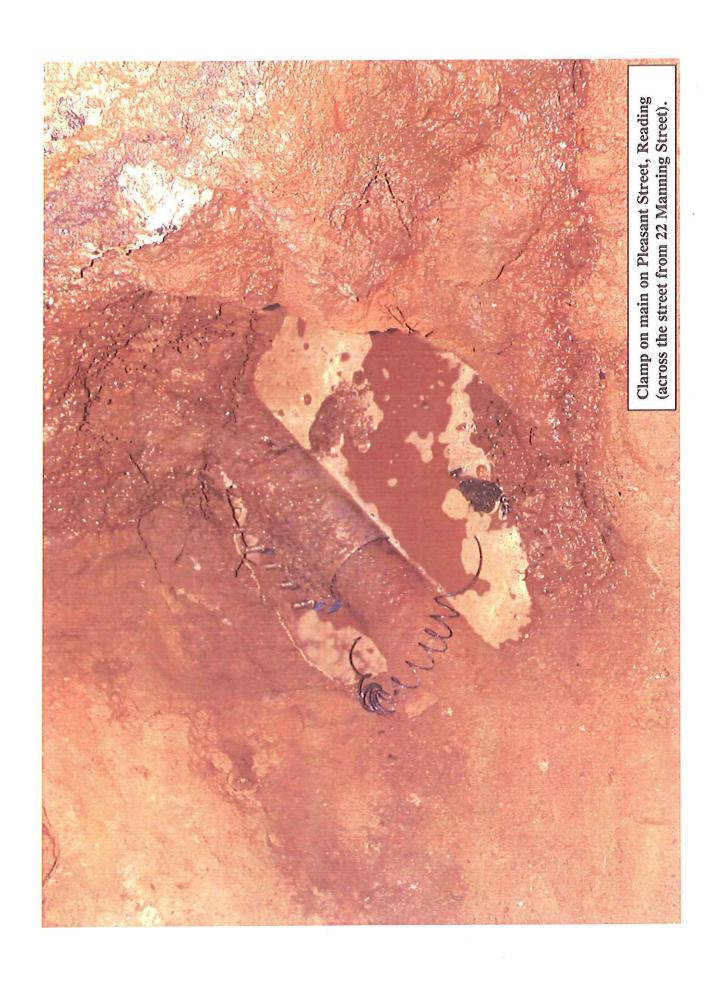

Summary of Records of Gas Mains

Information Request PL 1-4

Respondent: James Hughes

Request:

Provide records for the gas mains on Pleasant Street, Pleasant Street Extension and Manning Street, Reading, including but not limited to, installation date, MAOP, leak history from January 1, 2005 to January 25, 2010, and operating pressure at the time of the Incident.

Response:

- Installation Date =
 - Manning St = 1930, 1931, 1958
 - Pleasant St = 1930
 - Pleasant St Ext = 1930
- MAOP = 2 psig
- Leak History =
 - Manning St
 - o 1 joint repair at #20 on 03/02/2006
 - Pleasant St
 - o Broken main repair at #228 on 01/25/2010
 - o 1 joint repair at #228 on 01/27/2010
 - o 1 joint repair at #217 on 02/01/2010
 - o 3 joint repairs at #229 on 04/27/2009
 - o 3 joint repairs at #206 on 03/14/2006
 - Pleasant St Extension
 - No leak repair history
- Operating pressure at the time of the incident = 1.8 psig

Leakage Survey Maps

Information Request PL 1-11

Respondent:

Michael Verrell

Request:

Provide a map identifying the streets and boundaries that National Grid conducted leak surveys (flame ionization unit) on January 25, 2010, in the vicinity of the Incident. Identify in this map those areas that National Grid conducted a walking survey and those areas where the Operator conducted a mobile survey.

Response:

National Grid conducted a walking survey on Pleasant Street, Pleasant Street Extension and Manning Street after the incident on 1/25/10. National Grid also performed a mobile survey of Eaton Street, Smith Avenue and Azalea Circle on 1/25/10. National Grid then performed mobile surveys of Pleasant Street, Pleasant Street Extension and Manning Street twice a day from 1/26/10 through 2/1/10 and continued daily mobile surveys of Pleasant Street and Pleasant Street Extension through 2/15/10.

National Grid's Responses to the Department's First Set of Information Requests May 3, 2010

Information Request PL 2-9

Respondent:

Scott Croker

Request:

Response:

Refer to response to IR-PL-1-11. Provide a map identifying the streets and boundaries that National Grid conducted leak surveys (flame ionization unit) on January 25, 2010, in the vicinity of the Incident. Identify in this map those areas that National Grid conducted a walking survey and those areas where the Operator conducted a mobile survey.

Attached as Exhibit PL 2-9, please find a copy of map identifying those areas that

National Grid conducted leak surveys on January 25, 2010.

Coated Steel, High Pressure Cost Iron, Low Pressure Cast Iron, Intermediate Pressure Cast Iron, High Pressure Coated Steel, Intermediate Pressure Coated Steel, Low Pressure Cast Iron, Unknown Pressure Bara Steel, Unknown Bara Steel, Transmission Pressure Bare Steel, Low Pressure Bara Steel, Intermediate Pressure Baro Steel, High Pressure Copper, Low Pressure Coated Steel, Transmission Pressure Wrought Iron, Low Pressure ligh Density Plastic, High Pressure Copper, Unknown Pressure Unknown, Intermediate Pressure Jaknowa, High Pressure Wrought Iron, Unknown Wrought Iron, Intermediate Pressure Wrought Iron, High Pressure Plastic, Unknown Prossure Plastic, Transmission Pressure ligh Density Plastic, Low Pressure ligh Density Plastic, Intermediate ligh Density Plastic, Transmission Pressure ligh Density Plastic, Unknown Pressure istic, intermediate Pressure sted Steel, Unknown Pressure ic, High Pressure

(3 0 (a) 6" PL 2 PSIG 1997 5 Spir Disas January IS NOTAS 15 ID631d 6. PL 2 PSIG 2010 i si [] [] SALCIA [1] J. 气门 4.7 1 [1] T ... 6" CS 2 PSIG 1967 de la والمن الله 15 nou ET ! e. CI L.P. 1925 TR THOUSE AZALEA DR (15 F CI 2 PSIG 1914 RETHIN 133418 [F 6° CS 2 PSIG 1972

<u> 3</u>j

national**grid**

AMMS

Unknown, Low Pressure

Walking + mobile twice daily 1/26/10 thru 2/1/10

145

200

NOTE !: The localism of services pipose and commoden components are and guaranteed to be errored.

2P/PEC, are veed sea origined record documents, should be utilized for this formation.

NOTE 2: The matter in hill willboard dimensions are not drawn to each. These matter are knowled to show the existence of gas matter on the attest and do not mithed the exact location of the main in the attest.

mobil survey 1/25/10

Post-Incident Reported Leaks and Repairs

** A0.32A9 JATOT **			, MUZE 65		V 8586	-			
Date/Time: 01/2 Hse #: 355 Prefix:Prefix:	MASSACHUSET	TS LEAR	CINVES	IIGATIO	N KEPO	KI Assuss			
Date/Time: Otto	0-014	Premark	Date: _	0	ett	_ Compa	iny Coae):	-
Hise #: 355 Prefix:	_ On Street:	Maria	سندي	Su	mx:	_ Maximo) #:		
LMS #Pretix:	Cross St:	1011	14	su	тіх:	· lowu: _	150		
Leak classified by: 13524 Leak Standby	Leak Classificat	lon	[Bural]	eak Area	than	Public Public	Source	Project 136	X
Yes X No	1 N 2A 12	Press	INVIEW	Ness D	V811	Employee	9	136	1
Meter Location	LP IP		TP	Unimo	m	Winter Pa		146	
In Out X	Leak in Continuously Pa	ved Area		e Condition	Rpt	Summer		140	
Odor Present		X	The second secon	X) No		Pre Pave	-	134	
Yes X No	Cover		Main	Facility	ल्य	CI Encros	ach	128 132	<i>a</i>
Method of Test Portable FI	Concrete	/	Service			Special		138	V
Mobile FI	Brick		Drip			Walking		144	
CGI	Gravel		Curb Valve			Contracto	r	142	
Selected Test	Soil/Grass .		Main Valve Other			Building	144	130	ļ
Other	Other			ALC 1 1		Bus. Distr	ict	130	<u> </u>
	44557		247	95					
	X-3			(-2) Y-0					
									-
		27							
	OK-								
			14-2	%			#		
					共土				
	all-a Panna	/ Dools	Frank	/ Dank	I lat	/ Disks		A I Diela	
Type Code Rea		/ Back ance	10.00 per 10.00	/ Back on Code		: / Right stance		eft / Right ation Cod	
1 B-01 N									
2 C-01 29		, '	FE	(4)	1	3'	P	LIBL	
3 0-01 30				VO	<u> </u>		``	70-	
4 6-12 90		1	FI	=W		ξ '.	L	RBL	
5 5001	24. 5	3 '	FI	FW.	5		L	LBL	
6 6-01 0		<u>' </u>		= 1		6	1	RBL	
7 (-12 50	47 47	<u>.'</u>	<u> </u>	FW_	5	2'		LUBL	
8									
9									
10					-	-		1 27.4	· ··
12			******						
13	SAS. P. COLLEGE CO.				"				
14					J				
/ \	1.1/ 42	0) (0 1	M	. \ .	A	-	1 34	
Comments: 6 (24)	1991 26	7. 400	~ t^d	للم!! ر)-1751d	6 (m) #	195	ソシィナト	+
314% 115 W WARC	Secule (a) =	1357 6	13744	T. 189	Kall	CVS 1	p be	<u>~~~</u>	410
	Mui Karl	C	Employ		257 /	10 a 15			
Completed by (signature):	July 100	700C)	=mbio)	/ee #. <u> </u>	1100			VAAAR	//d #NA1
Consultant Company:								KS035	(נועוו)

LMS # <u>334</u>	116	5 Pi	refi	x: _		_ (cros	is :	St: ,	X	10	T		7	7		_	5	ШΠ	X1		_ '	υW	11:	^-		d Rich	U.U.	004	-
Leak classified I	by: \	277	<u>.b.</u>	_		Le	aak (Clas	SHIC	auo	n					40	enr	460			\neg		- And	PERM	Sou	rce	-т	. ,	ect 6 ·	7
			-	Ļ	1	l	2A		2	_	3	-			<u></u>	IN	- 31	Δ	0101		_		-	_	8		-	13		†
Ye's	-		لب	г		$\overline{}$	8	Т 1	5		$\overline{}$			re	TE	1		Uni	monn		7			-	_		-	14	All Property lies	1
1 2/2				Ļ			\triangle	1		Dav				اسل	A		Cor		2000	lo1		_	_	_	_			14	0	Ì
In A	-			ř	2000	-	Onli	nuo I			<u>V</u>	"	[-	1100	Ť	·No		52	\neg	F	re F	ave)			13	_	1
Yes X		<u> </u>	_	L	16	9	-	Co		-,1			L		Rest Virtual Public Employee I	12	-													
	Property and the	st	_	Γ	Ası	hall	t	-		T	X			Mai	1					×		-	_				_	13		4
Portable FI				Ī	Co	nçre	te						1						_								-	13		4
Mobile FI		X			-		_			1		=	-			1			4		\dashv		_		0.5		-	14	-	4
ÇGI		$\perp \times$	Ú_	L						-		_	- }						-	_	\dashv			-	01		-	13		1
Selected Test				-	4	Pressure Pressure	13		7																					
Other		<u> </u>		L	Oth	er			_			لے			υI	-		_		4	ᆜ	ظہ	100.		T	Ţ				f
		-		~		_			-					二	-	土	-	-		-					1.,			-		F
	-		7	2	(7			-	6				按	fit	-				-							-
				-	=		¥4.	6%	2		-			Luc			-							二				-		F
	, e-+- /-			~			-	-	-			-	-			C			上			=							-100	E
						X-2	_		10	-		-				~~		-	-				~~	二			-	415	_	F
				76.45	1				-			-	F		*	>4	1		<u> </u>	P-0	B								J	
		7								0	K-S	F	-		-	_	_	-	F					_	1		1,000		\exists	-
										2		-							-	\vdash					-					-
								_	-		O	O'	-	-				ļ	F	E		-					-	-		-
	- Pe	BU	竹-	5		=,,,,,,			,			=	-	-		4,000	-		F	-	-	-			F-					Ė
			Y-	147	-	-	-	di						_	X	1	-	-	K-	4			F		-				\neg	Ē
								-								-		-	_	-				-	BAL					F
			•			-					PLATF		7				Ι.				Υ.				_	=				
							4 1145		and tr			-	-					-		-				-	-					
	****				احججه			(L			A	L	land town	As serve			fi bid iiig			A stop II							_
Type (% G			ding				Fr	ont	/Ba	ck																			
,,,,,,		1							d	Dist	ance	9		1	Loc	atic	n C	ode			Distance					Location Co.)(
1 B-0)1	+		00	5			_													- (CV)	·								
	Type Code								***		1				. 4	-	W					2							_	
		† .							***	3	21										-	18	•							
		+-			9					_	-					_	_				4	31	1	٠	16					
					1			-		U	ŢŢ.			Γ													RI	23	4	
6 (-	fied by: Pak Standby No No Out Out Cor Present No Pihod of Test Concrete Brick Gravel Soll/Gras Other Yes Yes Other Yes Other Yes Other Yes Other Other Oth				पर	51																REBL								
7	- 1	+			-								•			5.00														
8					_									5000																
9	•			• •				out-			4	(B)					9					- 4	(A)							
10		+-				****			-																		٠,		ų	
11		+								_					*															
12		-			_									1														8		
13		+	diam'r.		-	~~~							10000	Ì												Γ				
14		-		-	_							-								T							1,000			
2)					8			-						d early									11							
Cammante.	6	cade	, '	2	١	P	K	,	る	56	ya.	- ^) A	1 4	T T	M	+	1.9	8	V	r Le	60	H	5	+		e	2K		
		1000		ب		1000	~	511	1.0		77		~	70	~~~	00	+.	カヘ	+	—);		-			•		-		-34-5	-
	400	0 1	TC	_ ;	74,	`		7	1,	<u>. </u>	W		*	142	1,	_	اللا	21						***					_	_
Cigo ears	- 1.		-								~																			

.....

MASSACHUSETTS LEAK INVESTIGATION REPORT Premark Date: Company Code: Date/Time: _/-28-10 Suffix: ST Maximo #: MAIN Hse #: 643 Prefix: On Street: __ Town: READING Cross St: PLEASANT Suffix: LMS#_____ Prefix: Leak Area Leak Classification Leak Source Project Leak classified by: Real / Urban 136 1 V2A 2 Public Leak Standby Rural 136 **Employee** V No Pressure Yes Minknown ! 146 Winter Patrol LP IP HP TP Meter Location V Out Premise Condition Rpt Summer FI 140 eak in Continuously Paved Area V No Pre Pave 134 Yes Odor Present No Yes CI Encroach 128 Facility No. Yes Cover Recheck 132 Main Method of Test Asphalt 138 Service Special Portable FI Concrete Drip 144 Walking Brick Mobile FI Curb Valve Contractor 142 CGI Gravel Building Main Valve 130 Soil/Grass Selected Test Other Bus. District 130 Other Other

				MAIN		
	IM A	IN ST		630 636	620/624	
	Type Code	Reading % Gas	Front / Back Distance	Front / Back Location Code	Left / Right Distance	Left / Right Location Code
1	B-01	10	1/5			
2	C-01					
3		5				
4						
5				 	3	
6	•					
7				 		
8				+		
9						
11			9			5-1-151
12				1		
13			***			
14						
Comp		nature): Amno		6@ Alpter 5		K8035 (11/06)
COLISE	· ·		1000770101	- 1000		וועוע זה פמזה פו

Date/Time: 1/2/ Hse #: 22 Prefix: LMS # Prefix:	10	Premari	k Date;	Compa	ny Code: 06C
Hse #: 22 & Prefix:	On Street:	Place	Suff	ix: 4 Maximo	#:
LMS # Prefix:	Cross St:	Maga	Suff	ix; St Town:	Kla
Leak classified by:	Leak Classific	ation	Leak Area/	Leak S	Source Project
Leak Standby	1 V 2A 2	3			136
Yes / No		Press	The state of the s	Employee	
Meter Location	LP IP	HP	TP Unknown		
Odor Present	Yes No		Premise Condition F	Rpt Summer F Pre Pave	140
Yes No	Cover		Facility	CI Encroa	
Method of Test	Asphalt		Main	Recheck	132
Portable FI	Concrete		Service	Special	138
Mobile FI	Brick		Drip Court Volum	Walking	144
CGI Selected Test	Gravel Soll/Grass		Curb Valve Main Valve	Contractor	
Other	Other	-	Other	Building Bus, Distri	130 ct 130
	T I I I			Bus, Dişur	GL 130
	278 201	-	;		7.8
	241				
					1
		1 7			7
(A) 1031.	Person	1	(1) (1)		
		1 1 1			
120 (1)0/		116			4-1
		-			
717.			397 245		
223 /220			235		
		t / Back	Front / Back	Left / Right	Left / Right
		stance	Location Code	Distance	Location Code
	6%				
2 C-01					
3					
4		,			
5				3	
6					1.
7					(*)
8				7	
9					
10					1
11					*** * ,
12					
13			,	<u> </u>	
14					
Comments: Horre	Baplosion	1 2	28, 37% 4z	35 who s	erie,
11 pt 4	729 to-	es FA =	1/01 1 11	24 12-1	(at a -1
Q:/, U-(W	per water	Colore	, IL, M. A.	y ricalea	The sense we
Completed by (elaneture)	4. Kus	4	Employee # 12	529	
Completed by (signature)	· / Cul		Employee #. 10~	/.//	KS035 (11/06)
	700				

1000220101

HISELISI EAN INVESTIGATION PERIODI

1	MASSA	CHUSET	TS LEAF	(INVESTIGATIO	N KEPOKI	ampany Code	
Date/Time: 1/26/10 Hse #: 355 Prefix: LMS # Prefix:	12:15	13.74.	Premark	Date:		ompany Code	ž
Hse #: 355_ Prefix:	On Str	eet:S	outh	Su	WX: 72 W	aximo #:	
LMS # · Prefix	Cro	oss St:		Su	ffix: To	mu: 15 D @	
Leak classified by: 15733	Leak	Classificati	on	Leak Area		Leak Source	Project
Leak Standby	1 12A	2	on 3	Rural Real U		ublic	136
Yes No			Press	ure		mployee	136
Meter Location	LP	IP (HP	TP Unkno		/inter Patrol	146
In Out		tinuously Pa	ved Area	Premise Condition		ummer FI re Pave	134
Odor Present	Yes ,	No		Yes No Facility		l Encroach	128
Yes No	Annhall	Cover		Main		echeck	132
Method of Test Portable FI	Asphalt Concrete			Service		pecial	138
Mobile FI	Brick			Drip		/alking	144
CGI	Gravel			Curb Valve	44444	ontractor	142
Selected Test	Soll/Grass	,		Main Valve		uilding	130
Other	Other	7		Other	B	us. District	130
+37		17/3	The state of the s				
77 32 711		1112	35				
J_2		V.		1			
X=3		V and	<u> </u>				
						out 5	
							1
,							+
	+						
				1	1 45/1	Diebt	Left / Right
	ading		t / Back	Front / Back Location Code	Left / I		cation Code
	Gas		tence			,	
1 B-01 0% 2 C-01 36		11/1	<u> </u>	NA	- 21/	A N	/A
2 C-01 36°	%	1'		FSW	G/	RL	
3 B-01 2%		NI	9	1/b	NIA	N	<u> </u>
4]					
5							
6							
7							
8							
9							
10							
11							
12				1			
13							
14			The state of the s				
Comments: My X-3 Food lead du Frost Condition	ring I	insid Ziger .	le 140 Enspe	E # 357 ction. Poss	at the	leats	Sorvice
Frost Condition	15.						
Completed by (signature):						•	KS035 (11/06
Consultant Company:				-			Nones (11/00

וואת זט בטוט בטיסי רת וסוטבבטטט

Rea. Jent .
Iformation Request

	-			_		_
RPT DATE	01/25/2010 12:00:00 AM	01/26/2010 12:00:00 AM	01/28/2010 12:00:00 AM	01/26/2010 12:00:00 AM	01/27/2010 12:00:00 AM	MA 00:00-12:01:07:01:01
ı		2		-	-	3
OPERATION AREA	MSFMAL	MSFMAL	MSFMAL	MSFMAL	MSFMAL	MSFWAI.
I TOWN		RDG	RDG	RDG	RDG	RDG
RPT ST SFX	ST .	ST	ST	ST	ST	ST
RPT ST NAME	PLEASANT	PLEASANT	MAIN	SOUTH	SOUTH	PRESCOTT
RPT ST PFX						
RPT ST NUMBER	. 228		625	355	355	
0	330075	330809	330246	330121	330171	330165
	RPT ST NUMBER RPT ST RPT ST NAME RPT ST SFX RPT TOWN OPERATION AREA CLASS	RPT ST NUMBER RPT ST PFX RPT ST NAME RPT ST SFX RPT TOWN OPERATION AREA CLASS 228 PLEASANT ST RDG MSFMAL 1	RPT ST NUMBER RPT ST PFX RPT ST SFX RPT TOWN OPERATION AREA CLASS 228 PLEASANT ST RDG MSFMAL 1 PLEASANT ST RDG MSFMAL 2	RPT ST NUMBER RPT ST PFX RPT ST NAME RPT ST SFX RPT TOWN OPERATION AREA CLASS 228 PLEASANT ST RDG MSFMAL 1 625 MAIN ST RDG MSFMAL 1	RPT ST NUMBER RPT ST PFX RPT ST SFX RPT ST SFX RPT TOWN OPERATION AREA CLASS 228 PLEASANT ST RDG MSFMAL 1 625 MAIN ST RDG MSFMAL 1 355 SOUTH ST RDG MSFMAL 1	RPT ST NUMBER RPT ST PRX RPT ST NAME RPT ST SFX RPT TOWN OPERATION AREA CLASS 228 PLEASANT ST RDG MSFMAL 1 625 MAIN ST RDG MSFMAL 1 355 SOUTH ST RDG MSFMAL 1 355 SOUTH ST RDG MSFMAL 1

	1	_	_		-			
	DIVISION	MSFMAL	MSFMAL	MSFMAL	MSFMAL	MSFMAL	MSFMAL	MSFMAL
	RPRD DATE	01/29/2010 12:00:00 AM	01/26/2010 12:00:00 AM	01/25/2010 12:00:00 AM	01/27/2010 12:00:00 AM	01/26/2010 12:00:00 AM	01/27/2010 12:00:00 AM	not repaired
	CLASS	1	2	1 .	1	1	1	3
	SFX	ST	ST	ST	ST	ST	ST	ST
LEAKS REPAIRED BY DIVISION	STNAME	MAIN	MANNING	PLEASANT	PLEASANT	SOUTH	SOUTH	PRESCOTT
LEAKS REP	PFX							
	ST#	625	22	228	228	355	355	
	TOWN	RDG	RDG	RDG	RDG	RDG	RDG	RDG
The second second second second	LEAK NO	330246	330809	330075	330075	330121	330171	330165
	MONOW	712592	714320	712155	712155	712270	712431	712422

Winter Patrol Leak Surveys 2005 to 2010

Information Request PL 1-6

Respondent: Brian Cotting

Provide all documentation memorializing the leakage surveys conducted on Request:

Pleasant Street, Pleasant Street Extension and Manning Street from December 1, 2005 to January 25, 2010 pursuant to National Grid's Winter Patrol Procedures. Include in your response a copy of the Operator's Winter Patrol Procedures.

Below please find a summary of National Grid's Winter Patrol surveys conducted Response:

on Pleasant Street, Pleasant Street Extension and Manning Street from December

1, 2005 to January 25, 2010. Please see attached as Exhibit PL 1-6, copies

National Grid's Winter Patrol Procedures for relevant time periods.

Winter Patrols

Winter Patrols 2005-2006

12/30/2005

1/9/2006

1/11/2006

1/19/2006

1/21/2006

1/31/2006,

2/1/2006

2/2/2006

2/16/2006

2/18/2006

2/27/2006

3/1/2006

3/08/2006

Winter Patrol 2006-07

2/07/2007

2/13/07

2/14/2007

2/23/2007

3/14/2007

Winter Patrol 2008-2009

1/16/2009

1/29/2009

2/5/2009

National Grid National Grid's Responses to the Department's First Set of Information Requests March 12, 2010


2/6/2009 2/11/2009 2/18/2009 2/23/2009 2/27/2009 3/5/2009

3/11/2009

3/18/2009 3/25/2009

3/26/2009

Pressure Test of Service to 22 Manning Street, Reading

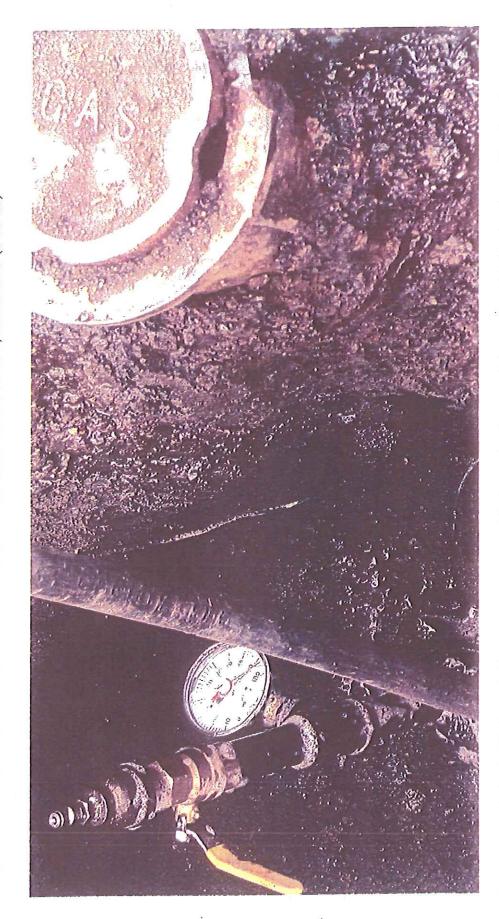

On January 26, 2010, National Grid pressure tested the 1-inch service line supplying gas to 22 Manning Street, Reading for 15 minutes at 90 pounds per square inch gauge. I observed no loss in pressure.

Robert McCabe, Department of Public Utilities Pipeline Engineering and Safety Division

Work (Order 714320 etion 824159	WorkType LR 22 MANNING ST,RDG	Status CASBUILT Town RDG
Oper	ation 20 Loc 824159	Standard Unit 22 MANNING ST,RDG	Count 1 Completion Date 2010-01-26-0.0
Work Activity 1 Where L	on LEAK Joint ype SERVICE eak LKPIPE	Paving Code Seal Replaced? Size 01 Leak Cause OTHER	Repairs # Main FT Inspected Repair sent to LM\$? Y Type of Joint Replaced Reason for Failure Material PL Pressure Contributing Factor Depth 3 Construction Type
RO	Standby? Reconnect?	House Heaters Ranges Comments	Relights Water Heaters Other
Pressure T Pressure Duration	Medium Chart?	Valve Inspect Primary V Valve Box Cle Comment	/alve? Location Verified ? Valve Greased Laned Valve Operability? CGI Reading (% Gas)

· 2

Summary of All Leak Surveys from 2005 to 2012

Information Request PL 1-5

Respondent: Brian Cotting

Request:

Provide the Division with all documentation memorializing the leakage surveys conducted on Pleasant Street, Pleasant Street Extension and Manning Street, re

from December 1, 2005 to January 25, 2010.

Response:

Below please find a summary National Grid's the leakage surveys conducted on Pleasant Street, Pleasant Street Extension and Manning Street from December 1, 2005 to January 25, 2010.

Walking Surveys

2005 8/25/2005

2008 Walking Survey 4/2008-6/2008 (National Grid performed walking survey of entire town during this timeframe including Pleasant Street, Pleasant Street Extension and Manning Street)

Mobile Surveys (of entire town of Reading)

Mobile Survey 2007

3/19, 3/20, 3/21, 3/22, 3/23, 3/27/2007

Mobile Survey 2009 5/1, 5/9, 5/5, 5/6

Winter Patrols

Winter Patrols 2005-2006

12/30/2005

1/9/2006

1/11/2006

1/19/2006

1/21/2006

1/31/2006,

2/1/2006

2/2/2006

2/16/2006

2/18/2006

2/27/2006

3/1/2006 3/08/2006

Winter Patrol 2006-07

2/07/2007

2/13/07

2/14/2007

2/23/2007

3/14/2007

Winter Patrol 2008-2009

1/16/2009

1/29/2009

2/5/2009

2/6/2009

2/11/2009

2/18/2009

2/23/2009

2/27/2009

3/5/2009

3/11/2009

3/18/2009

3/25/2009

3/26/2009

Spring Monitoring

2006 Monitoring

Grade 3 leaks on Pleasant Street were re-checked on 4/27/06, leak at 206 Pleasant Street had been repaired and leak at 97 Pleasant Street (remained Grade 3)

2007 Monitoring

Grade 3 leak at 97 Pleasant Street re-checked on 9/6/07 (remained Grade 3)

2008 Monitoring

Grade 3 leak at 97 Pleasant Street re-checked on 10/10/08 (remained Grade 3)

2009 Monitoring

Grade 3's at 97 and 217 Pleasant Street were re-checked on 12/2/09 (remained Grade 3's)

Odorant Level Tests

*)	×									
	21,	12	2	2	64.09	19943	12-A-01	S.	ТСР	料9 Reading Take Station Lowell St.
		170	,04	2.	00,09	1991-3	12-4.08	E GE	Lynn	#34 Lynnfield Fire Station 55 Summer St. Lynnfield
	-	-	205	-05	64-09	1911-3	12-2-08	T.	Mystic Town of Wakefield	#29 Wakefield Fire Station 5 Oak St. Wakefield
	.23	<u></u>	30.	90.	04-01	1991-3	D.Kog	Z.	Mystic	#28 Reading Fire Station 267 Woburn St. 1
	,12	4	, Ø 6	-06	BA-OR	1981-3	17,2,09	The state of the s	Mystic	#27 Burlington Fire Station 140 Terrace Hill
	10	./0	è	200	04-09	15813	124-01	RE	Mystic	#26 Lexington Air Base Grenier St. Lexington
	1/2	.12	.07	70.	30-40		17-2-09 1991-3	THE PROPERTY OF THE PROPERTY O	Mystic	#25 Arlington Fire Station 1 Monument Pk. Arlington
	,12	12	.06	36	69-09	1991-3	Port of	R	Myslic	#24 Winthrop Fire Station 40 Pauline St.
REMARKS:	% Gas Converted Disfinct	Odorator Distinct Reading	% Gas Converted Threshold	Odorator Threshold Reading	Odorator Odorator Calibration Threshold Date Reading	Odorator Serial #	Test Date	Test Test Conducted Date	Distribution System Tested	TION
		oup (North)	ning Grou	VEL TES	DISTINCT ODOR LEVEL TESTS Performed by: Propane & Gas Conditioning Group	INCT OF	DIST Periomac			Route #4
					İ					

		.11.		8	5/09	1-25-10/19113 5/09	1-25-10	LI.	16b	Reading Take Station Lowell St Reading
		<u>ب</u>		.08	5/09	1-25-10 1091 3 5/09	1-35-10	41	Lynn	Lynnfield Fire Station 55 Summer St. Lynnfield Lynnfield
	,	.11		.07	5/09	1-25-10 1991 3 5/09	1-25.10	3	Mystic Town of Wakefield	#29 Wakefield Fire Station 5 Oak St. Wakefield
		.10		.06	sloa	1-25-10 1991-3 5/09	1-25-10	<u>الم</u> ا الم	Mystic	#28. Reading Fire Station 267 Woburn St. Reading
	<u> </u>	13:			5/09	1.25.40 1991-3	1.25.10	4	Mystic	#27 Burlington Fire Station 140 Terrace Hill Burlington
deniral access.					5/09	1-25-10 1911-3	1-25-10	3	Mystic	#26 Lexington Air Base Grenier St Lexington
		. 10		.67	5/09	125-10 1991-3	1-25-10	4	Mystic	#25 Arlington Fire Station 1 Monument Pk Arlington
				80.	1991-3 5/09	1991-3	1 स्ट्र	muldbur I	Mystic	Winthrop Fire Station 40 Pauline St. Winthrop
REMARKS:	% Gas Converted Distinct	Odorator Distinct Reading	% Gas. Converted Threshold	Odorator Odorator Calibration Threshold Date Reading	Odorator Calibration Date	Odorator Serial #	Test	Test · Test Conducted Date By	Distribution System Tested	LOCATION
	,	Group (North)	STS oning Gro	EVEL TE	DISTINCT ODOR LEVEL TESTS Performed by: Propane & Gas Conditioning	TINCT (DIS			Route #4

:

¥

•

•

· ...·

•	leading Take Station owell St.	-ynniteld Fire Station 35 Summer St. -ynnifeld 49	Wakefield Fire Station 5 Oak St. Wakefield #34	Reading Fire Station 267 Woburn St. 1 Reading	Burlington Fire Station 140 Terrace Hill Burlington	Lexington Air Base Grenier St. Lexington	Arlington Fire Station 1 Monument Pk. Arlington #26	Winthrop Fire Station 40 Pauline St. Winthrop #25	LOCATION #24	Route M.	7
•	7GP	Lynn	Mystic Town bf Wakefield	Mystic	Mystic	Mystic	Mystic	Mystic	Distribution System Tested	- - .	
	-			1.7		<i>j 1</i>	~	Olds. 5	Test Test Conducted Date By		
•	J.	3	16)!	7	31	-	3,300 23.10	Date of	DIS Perform	
		7	-		-	11.	1 1	19913	Odorator Serial #	TINCT of by: Pro	
	,	-	:	١;٠	11	*	7	4.09	Oderator Celibration Date	ODOR L	ŀ
	2	20	30.	.05	2	.64	2	03	Odorator Odorator Celibration Threshold Date Reading	DISTINCT ODOR LEVEL TESTS omed by: Propane & Gas Conditioning)
	٨	is a	0	:es	E.	609	. 20.	8,	% Gas. Converted Threshold	DISTINCT ODOR LEVEL TESTS Performed by: Propane & Gas Conditioning Gro	
	. //	& .	12	09			09	The same of the sa	Odorator Distinct Reading	(HroN) duc	
	, ,	9	./2	09			90	. 10	% Gas Converted Distinct	ಶ	
							ě		REMARKS:		

("1

nationalgrid

Inter-office Memo Instrumentation & Regulation NE

To:

File

From

John Barrett

Date:

January 26, 2010

Subject:

228 Pleasant Street, Reading

On Monday, January 25, 2010 at approximately 6:30 p.m. John Doherty, Senior Supervisor, Instrumentation & Regulation was notified by Gas Control regarding an incident that occurred at 228 Pleasant Street. Reading. John Doherty, Senior Supervisor, Instrumentation & Regulation, and Jacques Moron (Instrumentation & Regulation Technician) went to the site to perform odor level tests. Tests were conducted at the Reading Take Station, Lowell Street, Reading, 235 Pleasant Street, Reading and John @ Haven regulator station, Reading. These locations are located in close proximity to the incident.

The results of these tests are listed below:

Date	Time	Location	Threshold Odor Level (% Gas in Air)	Distinct Odor Level (% Gas in Air)	Test Equip. ID	Test Equip. Calibration Date	Test By
1/25/2010	8:05 p.m.	Reading Take Station Lowell Street Reading	0.04	0.10	1991-3	5/2009	J.M.
1/25/2010	8:49 p.m.	John @ Haven	0.03	0.07	1991-3	5/2009	J.M.
	1	Reading	0.04	0.09	1991-3	5/2009	J.D.
			ж(
1/25/2010	9:38 p.m.	235 Pleasant Street	0.05	0.09	1991-3	5/2009	J.M.
		Reading	0.06	0.10	1991-3	5/2009	J.D.

Key to testing:

J.D. - John Doherty

J.M. - Jacque Moron

cc: J. Higgins

J. Gatherum

P. Vigeant

C. Aronson

J. Barrett

M. Eagan

M. Scaparotti